



Bulletin No.: PIC6597
Published date: 02/24/2025

Preliminary Information

PIC6597 Diagnostic Tip - Service Power Steering, Service Stabilitrak, Service Rear Drive, Service Restraint System U0075 and one or more of the following DTCs set U0131, U0151, U0420, U0452 B197D

Models

 
Brand: Model: Model Years:		VIN: from to		Engine:	Transmissions:
Cadillac CT5	2020 - 2024	All	All	All	All
Cadillac CT5-V	2020 - 2024	All	All	All	All

Involved Region or Country	North America
Condition	A customer may comment of the following messages displaying: Service Power Steering, Service Stabilitrak, Service Rear Drive, Service Restraint System. Upon investigation U0075 and one or more of the following DTC's will be set, U0131, U0151, U0420, U0452, B197D.
Cause	Possible Can 1 circuits 4986 or 4987 shorting on passenger seat frame.

Correction:

Inspect the passenger seat harness for chaffing on the seat frame, repair any damaged circuits and reroute harness to avoid contact.

Harness contacting seat frame.



CAN 1 circuit 4987 BU cut.



Harness routing to prevent contact.



Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
5430902	Wire-to-Wire Repair	Use Published Labor Time

Additional SI Keywords

can, can1, CT5, CT5-V, D2, drive, power, rear, restraint, restraints, service, stabilitrak, steer, steering, system, U0075, U0131, U0151, U0420, U0452

Version History

Version	1
Modified	02/24/2025 - Created on.