



Service Bulletin

Bulletin No.: PIT6304D

Date: May, 2025

PRELIMINARY INFORMATION

Subject: Diagnostic Aid: Service Leveling System Message And DTC: C1197 SYM92


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado EV RST	2024 - 2025		All	All	All	All
GMC	Sierra Denali EV	2024 - 2025		All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	F47 Air Ride Adaptive Suspension
Condition	Some customers may comment on following concerns: - Air leveling suspension is inoperative. - "Service Leveling System" message displayed in the DIC. - DTC: C1197 SYM 92.
Cause	This condition may be caused by a plugged or pinched air inlet hose to the air suspension compressor assembly or an internal suspension compressor assembly issue.

Correction

If you experience one of the conditions above, please check the following:

1) Inspect the air suspension compressor air inlet hose for being pinched or twisted and preventing air from entering the air suspension compressor. The air inlet hose assembly is shown as #17 below. If you find the air inlet hose pinched or twisted, repair as needed.

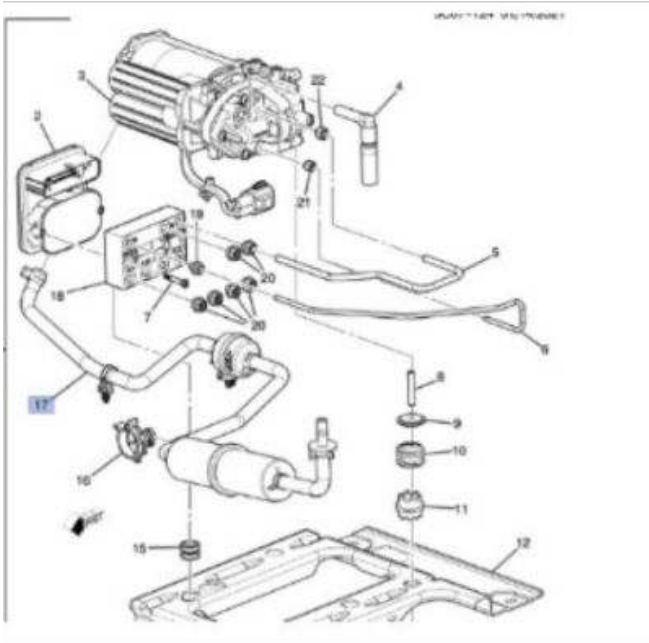

6787471


Silverado RST EV or GMC Denali EV may have a twisted hose near the inline air inlet filter.

See example below:



6787464

2) Inspect the inlet hose inside of the vehicle (under the rear seat) for being blocked by the rear harness. Check to see if the harness is laying on top of the air inlet hose nipple located to the right of the audio amplifier. See photos below:

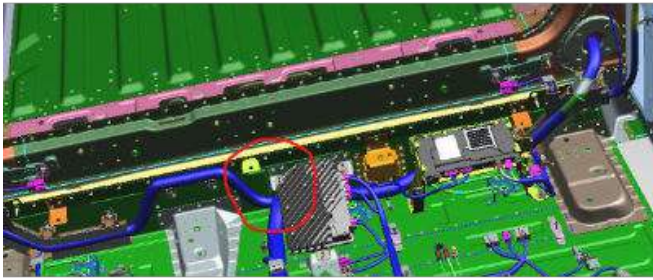

6787470



6787468

If the harness is restricting the air inlet hose, detach the harness retainer from the mounting stud and rotate the harness to provide additional clearance to the air inlet hose. If the harness clip becomes damaged during repair, install a new harness clip PN 13596799 and resecure the harness to the mounting stud.



6787466

3) After completing steps 1 and 2, perform vehicle wide programming per TSB 24-NA-143. Do not replace any parts. New software has also been released for the K5 Automatic Level Control Module

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*8080698	Verify Service Leveling System Message And DTC: C1197 SYM92	0.2
*This is a unique Labor Operation for Bulletin use only.		

Version	5
Modified	12/13/2024 - Created on. 01/27/2025- To make changes to correction field 03/24/2025- Add software update to correction field to address the C1197 DTC 04/16/2025- Updated Correction. 05/14/2025- Add an addition to the labor operation.