

Field campaign

Topic	Software Update BJB and HV ECUs Continental GT/GTC/Flying Spur 25MY (SC25/10)
Market area	Bentley: worldwide (2WBE),China 796 VW Import Comp. Ltd (Vico), Beijing (6796)
Brand	Bentley
Transaction No.	2077696/2
Campaign number	ED40
Note	
Type	
US code	

Vehicle data

25MY Continental GT/GTC/Flying Spur

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
Z23*	2025	E		*	*	*
Z24*	2025	E		*	*	*
Z32*	2025	E		*	*	*

Documents

Document name
master.xml
ed40_vinlist.pdf

.....

Notes



Repair instructions

Technical background

Software updates must be applied to update the vehicles Baseline Integration Level (BiL).

The software update corrects the following Diagnostic trouble codes (DTCs):

- P060100: High Voltage Battery (Address 008C) Internal Control Module Memory Checksum Error
- P057F00: Battery "A" State of Charge Performance, B11B300 Igniter for high voltage battery interrupt
- P0A0B00: High Voltage System Interlock Circuit Performance (HVIL).

Remedy

The instructions within the 'Work' section **must** be conducted to completion.

Customer notification

Please ensure all applicable instructions are conducted at the nearest opportunity.

Warranty

SVM Update Time

Claim type: 790 or 710

Service number: ED40

Damage code: 0066

Criteria:01

Labour Operation Code: 01 51 00 00

Time: As per ODIS log (Must not exceed 200TU)

Parts

Not Applicable

Parts supply

Not Applicable

Parts despatch control

Not Applicable

Repair instructions



Notes

Technical background

Software updates must be applied to update the vehicles Baseline Integration Level (BiL).

The software update corrects the following Diagnostic trouble codes (DTCs):

- P060100: High Voltage Battery (Address 008C) Internal Control Module Memory Checksum Error
- P057F00: Battery "A" State of Charge Performance, B11B300 Igniter for high voltage battery interrupt
- P0A0B00: High Voltage System Interlock Circuit Performance (HVIL).

Check

Check if the vehicle is already listed as repaired in "Repair history" (in ElsaPro).

Please also refer to the "Identification" section and check if a paint identification mark is evident in the vehicle.

If the vehicle is not shown in ElsaPro as repaired, and the identification mark is not present, please conduct the instructions within the 'Work' section to completion

Parts

Not Applicable

Work

 CAUTION
The Bentley ODIS-S Brand Version MUST be at least 2.35.2 (or higher).

 CAUTION
Before conducting the onward instructions, the operative MUST recheck the communication method in ODIS and ensure that DoIP is selected before proceeding. Within ODIS-S, perform the following: – On the right hand side, select the “Admin” tile (Within ‘Operating modes’) – Select “GFF sequence” (Within ‘General information’ section) – Under the “Selection of Communication path” drop-down menu, select “Only permit DoIP communication”.

 CAUTION
DO NOT, UNDER ANY CIRCUMSTANCES, ATTEMPT TO CONDUCT THE SOFTWARE UPDATE VIA THE CAN NETWORK. ONLY DoIP SHOULD BE USED WHEN PERFORMING THE SVM UPDATE.

 CAUTION
You MUST ONLY use the Diagnosis Interface VAS 6154 (WiFi Diagnostic Tool) in USB OPERATION or the CABLE-CONNECTED VAS 5055 for the reprogramming (updating) of the control units. – If neither of these units are available, the VAS 5054 (A) may be used in USB MODE. – DO NOT under any circumstances use a Bluetooth connection to conduct the reprogramming (updating) of any control units.

Battery Charger

 CAUTION
ONLY Chargers that meet the approved specification on the Mandatory Equipment List (available on the Bentley Hub) MUST be used. – The charger must be set to a mode where a MINIMUM of 90a is supplied to the battery during the process. Typically, this is known as ‘Power Supply Mode’ or ‘DIAG+ Mode’. – A voltage of exactly 14.8v must be set and maintained throughout the process. – Please refer to the manual to ensure that these requirements are met before beginning any SVM update


Preparation Before Update

 WARNING
Hybrid Vehicles use a High Voltage System and therefore MUST ONLY be worked on by suitable personnel

 CAUTION
During the update, switch off all unnecessary consumers. For example, ventilation, seat heaters, interior illumination, exterior lights ect.

Conduct a full guided fault find of the vehicle.

If a ‘Check Installation List’ pop-up appears, select ‘close’ (see below image)

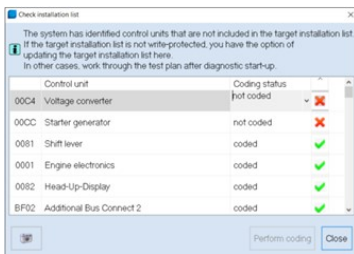

Referring to TPI 2075920, address any unknown faults **BEFORE** conducting any of the below updates.

Ensure that the correct battery charger is connected to the vehicle. – Refer to the “Battery Charger” Section above.

Obtaining Hotfix for ODIS-S

NOTICE

The Bentley ODIS-S Brand Version 2.35.2 does not require Hotfix. Only loading of the local flash files.

Visit <https://bentley.atheer.io/> and log in with the following case-sensitive account details.

- Username: bilupdate
- Password: Bentley123!

NOTICE

If you are already logged into your retailer account, you will need to logout first. To do this, click on your account initials (bottom left corner) and click “Sign Out”.

After logging in, using the navigation bar on the left hand side, click on the ‘conversations’ tab



Next, click the conversation named “ED40 Campaign”.

NOTICE

You MUST NOT leave the conversation, remove users from the conversation, delete the conversation or alter the conversation in any way. The ONLY action you are permitted to perform is download the applicable file required for this campaign.

In this conversation, you will find a file named “ED40_Local_Flash_Files”.

Left click the file name and download the folder.

After left-clicking the files to download them, the download may take circa 5-10 minutes, do not interrupt this process. You may need to wait a short period (internet speed dependent) for the files to download.

During/before the download commences, there may be a warning about a “pop-up” being blocked which will prevent the file from downloading, ensure to select option “Allow Pop-Ups from this website” to download the file. Wording may differ depending on web browser.

Locate the download file and extract it. To do this, right click the file, click "7 zip" and then "Extract here"

After successfully downloading the file, please logout of the account.

Downloading Flash Files for ODIS-S

From the content within the 'ED40_Local_Flash_Files' download, copy the content of the folder into your root c:/temp drive on your ODIS device.

- FL_4M0915249AN_0201_UPD0004T0005_V001_S.odx
- FL_4M0915249AM_0207_ABJB7A60590M1_V001_S.odx
- FL_4M0915231AH_0204_XHX15EV0421M6_V001_S.odx

High Voltage Shutdown

 WARNING
De-energise the high-voltage system via ODIS-S. Refer to ElsaPro, Repair Group 93 – "De-energising high-voltage system" to do so.

1. After de-energisation, Refer to ElsaPro Repair Group 70 'Boot carpet – To remove and fit'. Remove the boot floor and gain access to the earth cable from the 12v battery negative and the body in white (This access will be required later in the test plan).

2. Navigate to 'Special functions' and select 'SVM – Pre 372BIL5201 Hotfix Routines', then 'Perform test'.

3. Switch to 'DoIP' when prompted.

4a. For Continental Flying Spur Vehicles Select '1) BMC/BJB 204/207 Update Repair' and follow the on-screen instructions.

4b. For Continental GT/GTC Vehicles Select '8) BMC/BJB 204/207 Update Repair' and follow the on-screen instructions.

- When the tester attempts to flash '008C - Battery regulation control module' you may receive a message informing you that the pre-conditions have not been met. Select 'done/continue'.
- On the following screen (shown below) select option 2 to attempt to flash the ECU – this should allow the '008C - Battery regulation control module' to flash successfully.

 NOTICE
If the flash fails, perform the below actions.

1. Exit the test.

2. Allow the car to sleep for 5 minutes.

- Turn off the ignition.
- Remove all equipment from the car (Diagnostic tester/dongle, battery charger, keys).
- Close all doors, windows, bonnet and boot lid.
- Lock the vehicle to perform a CAN-BUS sleep (wait 5 minutes).

3. Clear DTCs from '008C - Battery regulation control module'.

3a. To do this, right click on control unit 008C, click Guided Functions and then click 'Clear Fault Memory'.

4. Return to 'Special functions' and run the test plan 'SVM – Pre 372BIL5201 Hotfix Routines'.
5. Within this test plan, select option 2 and run until completion.
6. Once the test has been completed, right click on control unit 008C and select guided functions. Then, read ECU Identification and ensure that the 06D0 (Battery Junction Box) appears as a subsystem within the read identification test plan.
7. Continue to the next SVM update.

SVM Code Input



WARNING

Re-energise the high-voltage system via ODIS-S. Refer to ElsaPro, Repair Group 93 – "Re-energising high-voltage system" to do so.

1. After re-energising the High Voltage System, navigate to the "Special Functions" tab in ODIS-S.
2. Navigate to 'SVM – Code Input' and enter the SVM Code.
 - a. If the vehicle is any variant of a Continental GT or GTC, enter the SVM Code: "372ED40COM01".
 - b. If the vehicle is any variant of a Continental Flying Spur, enter the SVM Code: "373ED40COM01".
3. On the next screen, ensure that the SVM code displayed is correct.
4. You will be shown the communication type. **This MUST be set to "DoIP"**.
 - a. If "DoIP" is not selected, select option 3 until the communication type is set to "DoIP".
5. After ensuring DoIP is selected, and a suitable battery charger is connected, select Option 1 – "Yes".
 - a. From here, all control modules will be interrogated and the SVM action will take place.
6. Ensure that the diagnostic device remains connected for the duration of the update.
7. Follow all on-screen prompts until the program ends.
 - a. If you have a prompt stating there is no communication established with 00CC, select done/continue.
8. Follow the on-screen instructions to completion.
9. If you are presented with this screen (Fig 3) at the end of the update, the update was successful. Please continue to step 11.

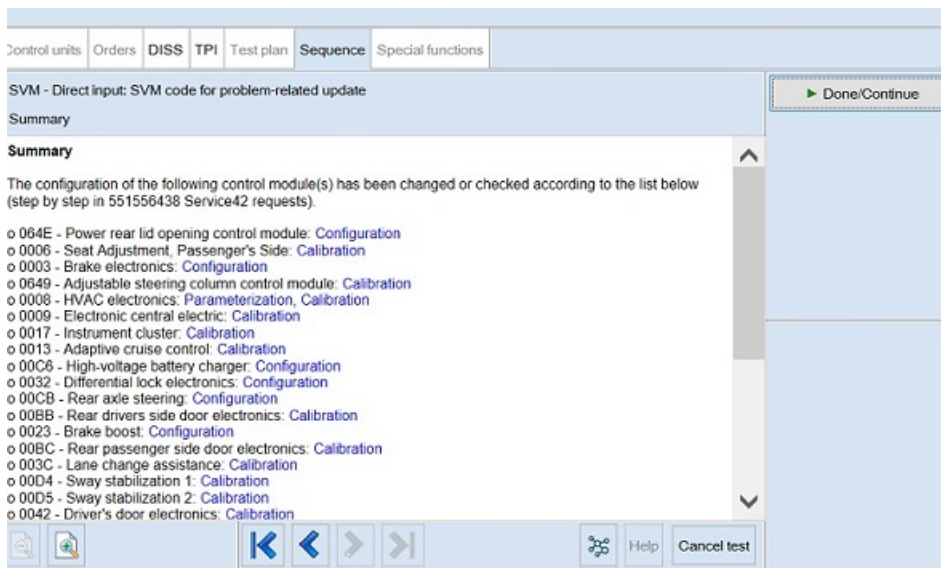


Fig 3

10. If you encounter any errors during the update, please raise a FULL TECHNICAL DISS query.

a. Customer Statement: "ED40 Support"

b. Workshop Findings: Give a summary of the error encountered and ensure that the latest Guided Fault Finding log is submitted online.

11. After successful completion of the update, perform the following.

- Turn off the ignition.
- Remove all equipment from the car (Diagnostic tester/dongle, battery charger, keys).
- Close all doors, windows, bonnet and boot lid.
- Lock the vehicle to perform a CAN-BUS sleep (wait 15 minutes).


12. After 15 minutes, unlock and open the driver's door. Turn on the ignition, re-connect the battery charger and diagnostic dongle.

13. Re-run guided fault finding and clear DTCs. If any faults are present, refer to TPI 2075920. If any other faults are present, please raise a full DISS query with a full GFF log uploaded online stating the error encountered.

Identification

Once the applicable action has been conducted, the operative must submit a warranty claim as this will show the service campaign action as complete within Elsa Pro "Repair history".

You must also add a yellow paint mark to the underside of the Fusebox cover as per the picture below.

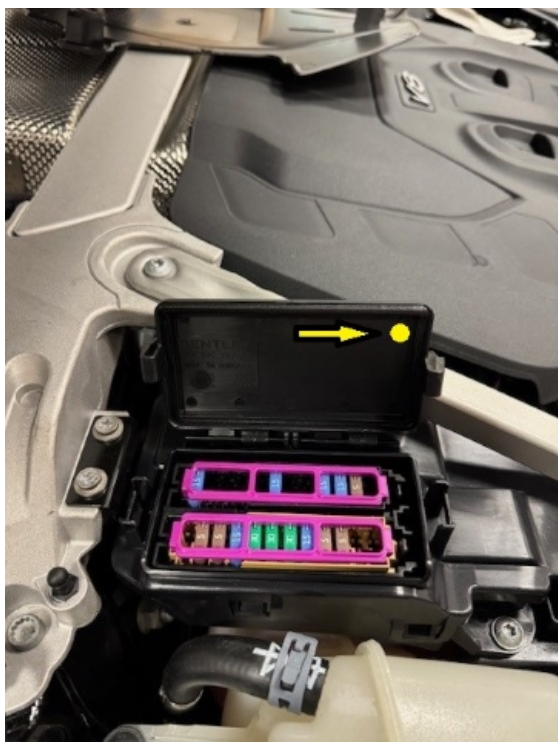

 [Repair instructions](#)  [Notes](#)

AMERICAS

SCBBP6ZG0SC022799
SCBBP6ZG1SC022682
SCBBP6ZG1SC022763
SCBBP6ZG1SC022911
SCBBP6ZG1SC023055
SCBBP6ZG1SC023122
SCBBP6ZG2SC022898
SCBBP6ZG2SC023114
SCBBP6ZG4SC023020
SCBBP6ZG5SC022703
SCBBP6ZG6SC022726
SCBBP6ZG6SC022760
SCBBP6ZG6SC022855
SCBBP6ZG8SC022775
SCBBP6ZG8SC022873
SCBBP6ZG9SC022994
SCBBP6ZG9SC023014
SCBBP6ZGXSC022891
SCBBP6ZGXSC022907
SCBBP6ZGXSC023023
SCBBR6ZG0SC022540
SCBBR6ZG0SC022649
SCBBR6ZG0SC022697
SCBBR6ZG0SC022795
SCBBR6ZG0SC022831
SCBBR6ZG0SC023008
SCBBR6ZG1SC022384
SCBBR6ZG1SC022448
SCBBR6ZG1SC022479
SCBBR6ZG1SC022496
SCBBR6ZG1SC022594
SCBBR6ZG1SC022644
SCBBR6ZG1SC022806
SCBBR6ZG1SC022885
SCBBR6ZG1SC023017
SCBBR6ZG2SC022409
SCBBR6ZG2SC022524
SCBBR6ZG2SC022605
SCBBR6ZG2SC022717
SCBBR6ZG2SC022748
SCBBR6ZG2SC022801
SCBBR6ZG2SC022829
SCBBR6ZG2SC022880

ASIA PACIFIC

SCBBF53S1SC022529
SCBBF53S1SC022580
SCBBF53S2SC022815
SCBBF53S3SC022581
SCBBF53S5SC022825
SCBBF53S6SC022476
SCBBF53S6SC022901
SCBBJ53S6SC022556
SCBBR53S0SC022481
SCBBR53S0SC022920
SCBBR53S0SC023033
SCBBR53S1SC022425
SCBBR53S1SC023039
SCBBR53S2SC022952
SCBBR53S3SC022569
SCBBR53S3SC023091
SCBBR53S4SC022404
SCBBR53S4SC022693
SCBBR53S4SC023097
SCBBR53S5SC022394
SCBBR53S6SC022663
SCBBR53S6SC022811
SCBBR53S7SC022834
SCBBR53S9SC022740
SCBBR53S9SC023144
SCBCF13S1SC022494
SCBCF13S1SC022530
SCBCF13S1SC022544
SCBCF13S2SC022424
SCBCF13S7SC022614
SCBCF13S7SC023195
SCBCF13S8SC022461
SCBCF13S9SC022467
SCBCF13SXSC022378
SCBCF13SXSC022414
SCBCF13SXSC022610
SCBCJ13S9SC022435
SCBCR13S4SC022545
SCBCR13S4SC022917
SCBCR13S6SC022725
SCBCR13S7SC023043
SCBCR13S8SC022807
SCBCR13S9SC022508

CHINESE MAINLAND HK AND
MACAO

SCBBF53S3SC022564
SCBBF53SXSC023047
SCBBG53S0SC022535
SCBBG53S0SC022549
SCBBG53S0SC022552
SCBBG53S0SC022728
SCBBG53S1SC022382
SCBBG53S1SC022513
SCBBG53S1SC022642
SCBBG53S2SC022522
SCBBG53S2SC022584
SCBBG53S2SC022603
SCBBG53S2SC022651
SCBBG53S2SC022746
SCBBG53S2SC022942
SCBBG53S3SC022433
SCBBG53S3SC022576
SCBBG53S4SC022571
SCBBG53S4SC022599
SCBBG53S4SC022876
SCBBG53S5SC022613
SCBBG53S5SC022661
SCBBG53S5SC022708
SCBBG53S5SC022711
SCBBG53S5SC022742
SCBBG53S5SC022837
SCBBG53S6SC022412
SCBBG53S6SC022460
SCBBG53S6SC022474
SCBBG53S6SC022507
SCBBG53S6SC022636
SCBBG53S6SC022667
SCBBG53S7SC023004
SCBBG53S7SC023035
SCBBG53S7SC023164
SCBBG53S8SC022492
SCBBG53S8SC022542
SCBBG53S8SC022623
SCBBG53S8SC022752
SCBBG53S8SC022895
SCBBG53S9SC022470
SCBBG53S9SC022498
SCBBG53S9SC022517

SCBBR6ZG2SC022930
SCBBR6ZG2SC023012
SCBBR6ZG3SC022466
SCBBR6ZG3SC022628
SCBBR6ZG3SC022631
SCBBR6ZG4SC022377
SCBBR6ZG4SC022427
SCBBR6ZG4SC022511
SCBBR6ZG4SC022640
SCBBR6ZG4SC022671
SCBBR6ZG4SC022766
SCBBR6ZG4SC022833
SCBBR6ZG4SC022847
SCBBR6ZG4SC022914
SCBBR6ZG4SC023058
SCBBR6ZG5SC022422
SCBBR6ZG5SC022436
SCBBR6ZG5SC022453
SCBBR6ZG5SC022520
SCBBR6ZG5SC022551
SCBBR6ZG5SC022601
SCBBR6ZG5SC022792
SCBBR6ZG5SC022839
SCBBR6ZG5SC022842
SCBBR6ZG5SC022887
SCBBR6ZG5SC023067
SCBBR6ZG6SC022509
SCBBR6ZG6SC022574
SCBBR6ZG6SC022638
SCBBR6ZG6SC022669
SCBBR6ZG6SC022817
SCBBR6ZG7SC022440
SCBBR6ZG7SC022485
SCBBR6ZG7SC022504
SCBBR6ZG7SC022695
SCBBR6ZG8SC022379
SCBBR6ZG8SC022396
SCBBR6ZG8SC022429
SCBBR6ZG8SC022558
SCBBR6ZG8SC022723
SCBBR6ZG8SC022849
SCBBR6ZG9SC022388
SCBBR6ZG9SC022438
SCBBR6ZG9SC022455
SCBBR6ZG9SC022472

SCBDF33S2SC022486
SCBDF33S3SC022383
SCBDF33S4SC022375
SCBDF33S4SC022635
SCBDF33S7SC022452
SCBDF33S8SC022489
SCBDR33S0SC023076
SCBDR33S1SC022776
SCBDR33S9SC022587
SCBDR33SXSC022632

SCBBG53S9SC022646
SCBBG53SXSC022445
SCBBG53SXSC022526
SCBBG53SXSC022719
SCBBG53SXSC022736
SCBBG53SXSC022851
SCBBG53SXSC023062
SCBCF13SXSC022655
SCBCG13S0SC022645
SCBCG13S1SC022573
SCBCG13S2SC023120
SCBCG13S3SC022381
SCBCG13S4SC022437
SCBCG13S4SC022499
SCBCG13S4SC022583
SCBCG13S6SC023024
SCBCG13S7SC022397
SCBCG13S7SC023128
SCBCG13S8SC022490
SCBCG13S9SC022434
SCBCG13S9SC022840
SCBCG13S9SC022935
SCBCG13S9SC023115
SCBCG13SXSC022832
SCBDF33SXSC022512
SCBDG33S0SC022418
SCBDG33S3SC022543
SCBDG33S3SC022624

SCBBR6ZG9SC022620
SCBBR6ZG9SC022701
SCBBR6ZG9SC022827
SCBBR6ZG9SC022925
SCBBR6ZGXSC022416
SCBBR6ZGXSC022450
SCBBR6ZGXSC022464
SCBBR6ZGXSC022514
SCBBR6ZGXSC022531
SCBBR6ZGXSC022562
SCBBR6ZGXSC022609
SCBBR6ZGXSC022657
SCBBR6ZGXSC022819
SCBBR6ZGXSC022867
SCBCP2ZG0SC022749
SCBCP2ZG0SC022993
SCBCP2ZG0SC023075
SCBCP2ZG2SC023126
SCBCP2ZG3SC022678
SCBCP2ZG3SC022888
SCBCP2ZG3SC023068
SCBCP2ZG5SC022830
SCBCP2ZG5SC022908
SCBCP2ZG6SC022822
SCBCP2ZG6SC023002
SCBCP2ZG8SC022949
SCBCP2ZG9SC022684
SCBCP2ZG9SC022698
SCBCP2ZG9SC023107
SCBCP2ZG9SC023138
SCBCP2ZGXSC023178
SCBCR2ZG0SC022387
SCBCR2ZG0SC022406
SCBCR2ZG0SC022566
SCBCR2ZG0SC022616
SCBCR2ZG0SC022650
SCBCR2ZG0SC022793
SCBCR2ZG0SC022812
SCBCR2ZG1SC022575
SCBCR2ZG1SC022608
SCBCR2ZG1SC022625
SCBCR2ZG1SC022852
SCBCR2ZG1SC022947
SCBCR2ZG1SC022995
SCBCR2ZG2SC022505

SCBCR2ZG2SC022519
SCBCR2ZG2SC022553
SCBCR2ZG2SC022570
SCBCR2ZG3SC022402
SCBCR2ZG3SC022495
SCBCR2ZG3SC022593
SCBCR2ZG4SC022408
SCBCR2ZG4SC022523
SCBCR2ZG4SC022568
SCBCR2ZG4SC022733
SCBCR2ZG5SC022689
SCBCR2ZG5SC022739
SCBCR2ZG5SC022854
SCBCR2ZG6SC022376
SCBCR2ZG6SC022538
SCBCR2ZG6SC022541
SCBCR2ZG6SC022619
SCBCR2ZG6SC022877
SCBCR2ZG6SC023141
SCBCR2ZG7SC022533
SCBCR2ZG7SC022550
SCBCR2ZG7SC022659
SCBCR2ZG7SC022709
SCBCR2ZG7SC022774
SCBCR2ZG7SC022953
SCBCR2ZG7SC023147
SCBCR2ZG8SC022458
SCBCR2ZG8SC022475
SCBCR2ZG8SC022637
SCBCR2ZG8SC022816
SCBCR2ZG8SC022928
SCBCR2ZG9SC022484
SCBCR2ZG9SC023022
SCBCR2ZG9SC023084
SCBCR2ZGXSC022641
SCBCR2ZGXSC022767
SCBCR2ZGXSC022798
SCBCR2ZGXSC022879
SCBCR2ZGXSC022932
SCBCR2ZGXSC023109
SCBDP4ZG0SC022802
SCBDP4ZG0SC022945
SCBDP4ZG1SC022677
SCBDP4ZG1SC022758
SCBDP4ZG3SC023071

SCBDP4ZG4SC022866
SCBDP4ZG4SC023029
SCBDP4ZG4SC023175
SCBDP4ZG6SC022836
SCBDP4ZG7SC022683
SCBDP4ZG8SC022899
SCBDP4ZG9SC022782
SCBDP4ZG9SC022846
SCBDP4ZG9SC022894
SCBDP4ZGXSC023133
SCBDR4ZG0SC022941
SCBDR4ZG1SC022656
SCBDR4ZG1SC022768
SCBDR4ZG1SC023063
SCBDR4ZG2SC022391
SCBDR4ZG2SC022567
SCBDR4ZG2SC022598
SCBDR4ZG2SC022617
SCBDR4ZG2SC023072
SCBDR4ZG3SC022447
SCBDR4ZG3SC022500
SCBDR4ZG3SC022528
SCBDR4ZG3SC022612
SCBDR4ZG3SC022724
SCBDR4ZG4SC022411
SCBDR4ZG4SC022456
SCBDR4ZG4SC022652
SCBDR4ZG4SC022747
SCBDR4ZG4SC022893
SCBDR4ZG4SC022926
SCBDR4ZG5SC022126
SCBDR4ZG5SC022403
SCBDR4ZG5SC022482
SCBDR4ZG5SC022532
SCBDR4ZG5SC022577
SCBDR4ZG5SC022627
SCBDR4ZG5SC022658
SCBDR4ZG6SC022426
SCBDR4ZG6SC022765
SCBDR4ZG7SC022385
SCBDR4ZG7SC022502
SCBDR4ZG7SC022600
SCBDR4ZG7SC022662
SCBDR4ZG8SC022668
SCBDR4ZG8SC023108

SCBDR4ZG9SC022579
SCBDR4ZG9SC022999
SCBDR4ZGXSC022459
SCBDR4ZGXSC022462
SCBDR4ZGXSC022929

EUROPE
SCBBF53S0SC022537
SCBBF53S0SC022554
SCBBF53S0SC022909
SCBBF53S1SC022420
SCBBF53S1SC022918
SCBBF53S2SC022653
SCBBF53S3SC022547
SCBBF53S3SC022757
SCBBF53S4SC022590
SCBBF53S5SC022386
SCBBF53S5SC022730
SCBBF53S5SC022789
SCBBF53S7SC022860
SCBBF53S8SC022690
SCBBF53S9SC022715
SCBBF53S9SC022777
SCBBJ53S0SC022732
SCBBJ53S6SC023027
SCBBL53S2SC022676
SCBBL53S4SC022744
SCBBL53S4SC022808
SCBBL53S5SC022431
SCBBL53S7SC022821
SCBBL53S8SC022844
SCBBL53S8SC022858
SCBBL53S9SC022674
SCBBL53S9SC022786
SCBBL53S9SC023162
SCBBL53SXSC022781
SCBCF13S0SC022454
SCBCF13S0SC022471
SCBCF13S0SC022521
SCBCF13S0SC022597
SCBCF13S0SC022633
SCBCF13S0SC022700
SCBCF13S0SC022759
SCBCF13S0SC022809
SCBCF13S0SC022826

INTERNAL
SCBBL53S8SC022875
SCBCL13S1SC023038

MIDDLE EAST AFRICA & INDIA
SCBBF53S4SC023111
SCBBF53SXSC022626
SCBBF5ZG0SC022685
SCBBF5ZG2SC022560
SCBBF5ZG2SC022588
SCBBF5ZG2SC022607
SCBBF5ZG2SC023093
SCBBF5ZG4SC022611
SCBBF5ZG5SC022407
SCBBF5ZG7SC022862
SCBBF5ZG9SC022457
SCBBF5ZG9SC022488
SCBBF5ZGXSC022483
SCBBF5ZGXSC022936
SCBCF13S9SC022954
SCBCF13SXSC022803
SCBCF1ZG0SC022442
SCBCF1ZG0SC023168
SCBCF1ZG1SC022871
SCBCF1ZG1SC023146
SCBCF1ZG2SC023088
SCBCF1ZG3SC023083
SCBCF1ZG6SC022770
SCBCF1ZG7SC022602
SCBCF1ZG9SC022634
SCBCF1ZG9SC022665
SCBCH13S0SC022772
SCBCH13S4SC022712
SCBCJ13S0SC022923
SCBCJ13S2SC022390
SCBCJ13S6SC022506
SCBDF3ZG3SC022595
SCBDF3ZG8SC022415
SCBDF3ZG8SC022639
SCBDJ33S8SC022491
SCBDJ3ZG9SC022518

SCBCF13S0SC022857
SCBCF13S0SC023099
SCBCF13S1SC022463
SCBCF13S1SC022477
SCBCF13S1SC022480
SCBCF13S1SC022527
SCBCF13S1SC022673
SCBCF13S1SC022785
SCBCF13S1SC022897
SCBCF13S1SC023127
SCBCF13S1SC023158
SCBCF13S2SC022536
SCBCF13S2SC022780
SCBCF13S2SC022889
SCBCF13S2SC022892
SCBCF13S2SC022939
SCBCF13S2SC023086
SCBCF13S3SC022660
SCBCF13S3SC022741
SCBCF13S3SC022769
SCBCF13S3SC022903
SCBCF13S3SC023050
SCBCF13S3SC023064
SCBCF13S4SC022439
SCBCF13S4SC022604
SCBCF13S4SC022666
SCBCF13S4SC022778
SCBCF13S4SC022828
SCBCF13S5SC022417
SCBCF13S5SC022451
SCBCF13S5SC022465
SCBCF13S5SC022501
SCBCF13S5SC022823
SCBCF13S5SC023003
SCBCF13S5SC023096
SCBCF13S6SC022393
SCBCF13S6SC022510
SCBCF13S6SC022586
SCBCF13S6SC022622
SCBCF13S6SC022670
SCBCF13S6SC022720
SCBCF13S6SC022796
SCBCF13S6SC022913
SCBCF13S6SC023009
SCBCF13S6SC023057

SCBCF13S7SC022421
SCBCF13S7SC022578
SCBCF13S7SC022743
SCBCF13S7SC022869
SCBCF13S8SC022380
SCBCF13S8SC022654
SCBCF13S8SC022718
SCBCF13S8SC022783
SCBCF13S8SC022881
SCBCF13S8SC023061
SCBCF13S9SC022405
SCBCF13S9SC022419
SCBCF13S9SC022565
SCBCF13S9SC022596
SCBCF13S9SC022629
SCBCF13S9SC022937
SCBCF13S9SC023019
SCBCF13S9SC023036
SCBCF13S9SC023117
SCBCF13SXSC022557
SCBCF13SXSC022591
SCBCF13SXSC022722
SCBCF13SXSC022865
SCBCF13SXSC023000
SCBCJ13S0SC023134
SCBCJ13S1SC022672
SCBCJ13S6SC023025
SCBCJ13SXSC022413
SCBCL13S0SC022687
SCBCL13S0SC022818
SCBCL13S0SC023077
SCBCL13S1SC022729
SCBCL13S1SC022794
SCBCL13S1SC023069
SCBCL13S2SC022691
SCBCL13S2SC022710
SCBCL13S2SC022884
SCBCL13S2SC022996
SCBCL13S2SC023081
SCBCL13S2SC023131
SCBCL13S3SC022702
SCBCL13S3SC022845
SCBCL13S3SC022859
SCBCL13S4SC022790
SCBCL13S4SC022921

SCBCL13S4SC023101
SCBCL13S6SC022886
SCBCL13S6SC022919
SCBCL13S6SC023049
SCBCL13S7SC022735
SCBCL13S7SC022931
SCBCL13S7SC023092
SCBCL13S8SC022713
SCBCL13S8SC022761
SCBCL13S9SC023112
SCBCL13S9SC023157
SCBCL13SXSC022874
SCBCL13SXSC022938
SCBCL13SXSC023037
SCBCL13SXSC023054
SCBCL13SXSC023166
SCBDF33S0SC022423
SCBDF33S0SC022731
SCBDF33S0SC022762
SCBDF33S1SC022592
SCBDF33S1SC022902
SCBDF33S1SC023015
SCBDF33S2SC022441
SCBDF33S2SC022469
SCBDF33S2SC022696
SCBDF33S2SC023105
SCBDF33S3SC022478
SCBDF33S3SC022559
SCBDF33S3SC022643
SCBDF33S3SC022755
SCBDF33S3SC022805
SCBDF33S3SC022870
SCBDF33S3SC022948
SCBDF33S4SC022389
SCBDF33S4SC022473
SCBDF33S4SC023087
SCBDF33S4SC023137
SCBDF33S5SC022630
SCBDF33S5SC022773
SCBDF33S5SC023034
SCBDF33S5SC023048
SCBDF33S6SC022555
SCBDF33S6SC023060
SCBDF33S7SC022497
SCBDF33S7SC022516

SCBDF33S7SC022841
SCBDF33S7SC022905
SCBDF33S8SC022525
SCBDF33S8SC022539
SCBDF33S8SC022606
SCBDF33S8SC022797
SCBDF33S8SC022864
SCBDF33S9SC022534
SCBDF33S9SC022582
SCBDF33SXSC022395
SCBDF33SXSC022428
SCBDF33SXSC022686
SCBDF33SXSC022784
SCBDF33SXSC023031
SCBDL33S0SC022771
SCBDL33S0SC022916
SCBDL33S0SC023113
SCBDL33S2SC022934
SCBDL33S3SC022814
SCBDL33S4SC022675
SCBDL33S4SC023051
SCBDL33S5SC022779
SCBDL33S5SC023110
SCBDL33S6SC022788
SCBDL33S9SC022820

UNITED KINGDOM

SCBBF53S0SC022392
SCBBF53S0SC022618
SCBBF53S7SC022664
SCBBF53S9SC023041
SCBBL53S1SC022927
SCBBL53S3SC022721
SCBBL53S5SC022882
SCBBL53S7SC022804
SCBBL53S7SC022933
SCBBL53S7SC023001
SCBBL53S9SC022688
SCBBL53SXSC022750
SCBCF13S0SC022468
SCBCF13S0SC022843
SCBCF13S1SC022561
SCBCF13S2SC022410
SCBCF13S2SC022648
SCBCF13S4SC022487

SCBCF13S5SC022515
SCBCF13S5SC023132
SCBCF13S6SC022443
SCBCF13S6SC022863
SCBCF13S6SC022944
SCBCF13S9SC022503
SCBCF13S9SC022548
SCBCF13S9SC022694
SCBCF13SXSC023028
SCBCL13S0SC022446
SCBCL13S0SC022737
SCBCL13S0SC022835
SCBCL13S0SC022883
SCBCL13S0SC022950
SCBCL13S0SC023046
SCBCL13S1SC022813
SCBCL13S1SC022861
SCBCL13S1SC023119
SCBCL13S1SC023136
SCBCL13S2SC023145
SCBCL13S3SC022764
SCBCL13S3SC023056
SCBCL13S3SC023090
SCBCL13S4SC022756
SCBCL13S4SC022787
SCBCL13S4SC023065
SCBCL13S4SC023163
SCBCL13S6SC022838
SCBCL13S6SC022998
SCBCL13S6SC023018
SCBCL13S7SC022850
SCBCL13S7SC022900
SCBCL13S7SC023013
SCBCL13S7SC023044
SCBCL13S8SC022727
SCBCL13S8SC022890
SCBCL13S8SC022906
SCBCL13S8SC023103
SCBCL13S9SC023059
SCBCL13SXSC022681
SCBCL13SXSC022924
SCBCL13SXSC023006
SCBCL13SXSC023152
SCBDF33S0SC022647
SCBDF33S0SC022714

SCBDF33S0SC023040
SCBDF33S1SC022432
SCBDF33S4SC022585
SCBDF33S5SC022546
SCBDF33S5SC022563
SCBDF33S6SC022572
SCBDF33SXSC022493
SCBDL33S1SC022679
SCBDL33S2SC022951
SCBDL33S2SC023095
SCBDL33S3SC022716
SCBDL33S4SC022868
SCBDL33S5SC022751
SCBDL33S5SC023074
SCBDL33S5SC023124
SCBDL33S6SC022791
SCBDL33S6SC022810
SCBDL33S6SC022824
SCBDL33S6SC022872
SCBDL33SXSC022910