

Audi On-car analysis list from October, 1, 2025

Please contact Audi Helpline before attempting repair

Please see TSB 2066297 '00 VIN-4-PIN reporting program (V4P, vin4pin) for more info about the program

	Models	MY	Engine	Trans	Topic	Topic details
	Q8 e-tron	2023-2024	any	Any	Brake pulsation	Pictures of the brake disc; brake pads; Proceed with Run-Out measurements - (follow TSB 2022584) Include measurements in the TAC case.
	A4, A5, Q5, A6, A7, Q7, Q8	2024-2025	any	Any	MIB3 takes a long time to load at startup	During initial bootup the MMI system takes a long time to load. Once loaded, the "User" tile is missing from the MMI home page. MMI will then typically load as a guest user. MMI system works normally otherwise. On site analysis needed. Contact TAC for further instruction
	A4, A5	2021-2025	any	Any	Difficult to fuel, EVAP canister parts block - 8W0201801M	On site analysis needed. Contact TAC for further instruction
	Q5 (GU)	2025	2.0L	Any	P001700: Crankshaft Position-Camshaft Position Correlation Bank 1 Sensor B	1.Verify P001700: Crankshaft Position-Camshaft Position Correlation Bank 1 Sensor B 2.Please open TAC ticket for possible onsite.
	Q5, A5 (GU, FU)	2025	2.0L	Any	MIL on DTC stored in 812C: U041800: Invalid Data from Brake Control System A	On site analysis needed. Contact TAC for further instruction
	2019-2023	e-tron quattro	any	Any	drive-motor coolant and gear oil cross contamination	• Photos of the coolant reservoir or coolant collected from the front drive motor • Photos of the gearbox fluid sample (in a white cup at a 45°) • Photos of any debris collected from the gearbox • Could you verify the customer concern? • Have there been any prior repairs to the drive motor or gearbox? If there are prior repairs to the drive motor this document can be disregarded.
	2025	A5, Q5, A6 e-tron, Q6 (FU, GU, GH, GF)			PPE - PPC vehicles time is off by 1 hour	Photo of time in cluster, time settings in MMI, another phone with navigation location and time all in one photo • Read all MVB's from Da0075 while issue is NOT present • Read all MVB's from Da0075 when issue is actively occurring (document the log ID to correspond) • Provide specific location information as to where and how the duplicate • Can this be duplicated on other vehicles? • Is the area of concern close to another time zone? • Please provide an address or GPS location of the area in which the concern happens