

## Technical Service Bulletin

|                        |                                                                                                                   |
|------------------------|-------------------------------------------------------------------------------------------------------------------|
| <b>Topic</b>           | 96 Various messages relating to driver assist systems, event memory entry U110100 logged in various control units |
| <b>Market area</b>     | United States 444 Volkswagen of America, Inc. (6444)                                                              |
| <b>Brand</b>           | Audi                                                                                                              |
| <b>Transaction No.</b> | 2079729/1                                                                                                         |
| <b>Level</b>           | EH                                                                                                                |
| <b>Status</b>          | Released for publishing                                                                                           |
| <b>Release date</b>    | Oct 22, 2025                                                                                                      |

### Diagnostic trouble codes

| Diagnostic address             | Diagnostic trouble code              | Fault symptom | Storage state |
|--------------------------------|--------------------------------------|---------------|---------------|
| 8109 - Short-range radar 1     | U110100: Component protection active |               | static        |
| 810A - Short-range radar 2     | U110100: Component protection active |               | static        |
| 810C - Short-range radar 4     | U110100: Component protection active |               | static        |
| 0013 - Adaptive cruise control | U110100: Component protection active |               | static        |
| 008B - Distance regulation 2   | U110100: Component protection active |               | static        |
| 810B - Short-range radar 3     | U110100: Component protection active |               | static        |

### New customer code

| Object of complaint                                                                                                         | Complaint type                           | Position |
|-----------------------------------------------------------------------------------------------------------------------------|------------------------------------------|----------|
| assistance systems, comfort controls -> cross-traffic assist -> cross-traffic warning caused by an object                   | functionality -> no function             |          |
| information, navigation, communication, entertainment -> indicator display symbols -> exit warning system indicator display | functionality -> activates               |          |
| assistance systems, comfort controls -> exit warning system -> exit warning caused by an object                             | functionality -> no function             |          |
| information, navigation, communication, entertainment -> driver information system (DIS, MFI, MMI) -> text display          | functionality -> activates               |          |
| assistance systems, comfort controls -> cross-traffic assist -> cross-traffic assist monitoring mode activation             | functionality -> no function             |          |
| assistance systems, comfort controls -> emergency braking function -> automatic emergency braking (Front Assist)            | functionality -> no function             |          |
| assistance systems, comfort controls -> lane change assistance -> lane change assist monitoring mode activation             | functionality -> no function             |          |
| information, navigation, communication, entertainment -> warning display symbols -> active warning warning display          | functionality -> activates               |          |
| information, navigation, communication, entertainment -> driver information system (DIS, MFI, MMI) -> text display          | functionality -> activates without cause |          |
| assistance systems, comfort controls -> exit warning system -> exit warning system monitoring mode activation               | functionality -> no function             |          |

# Vehicle data

## Audi Q6

### Sales types

| Type | MY   | Brand | Designation | Engine code | Gearbox code | Final drive code |
|------|------|-------|-------------|-------------|--------------|------------------|
| GF*  | 2025 | A     |             | *           | *            | *                |

### Control units

| Diagnostic address                 | Software part number | Software version | Hardware part number | Hardware version |
|------------------------------------|----------------------|------------------|----------------------|------------------|
| 0009 - Electronic central electric | *                    | 1437             | *                    | *                |
| 0009 - Electronic central electric | *                    | 1436             | *                    | *                |
| 0009 - Electronic central electric | *                    | 1496             | *                    | *                |

## Documents

| Document name                             |
|-------------------------------------------|
| <a href="#">master.xml</a>                |
| <a href="#">schnellerebearbeitung.jpg</a> |



Connection offline

## Technical Service Bulletin

Transaction No.: **2079729/1**

96 Various messages relating to driver assist systems, event memory entry U110100 logged in various control units

Release date: Oct 22, 2025

## Condition

### Customer states:

Various messages relating to driver assist systems.

### Workshop findings:

The customer statement can be reproduced.

The entry **“U110100: Component protection active, active/static, symptom: 1231633”** is logged in one or more event memories of the short-range radars (diagnostic addresses 8109, 810A, 810B, 810C) and/or adaptive cruise control units (diagnostic addresses 0013, 008B).

## Technical Background

Due to a software issue in onboard supply control unit -J519- (diagnostic address 0009), the component protection in the short-range radars is no longer deactivated.

Functional issues occur when component protection is active.

## Production Solution

Production change in the fourth quarter of 2025.

## Service

This TSB replaces Pending Service Solution (PSS) TSB 2078209: *91 PSS Various messages relating to driver assist systems, event memory entry U110100 logged in various control units* for Q6 e-tron vehicles.

Please check whether TSB 2079690, *00 Combined software update 03.10.00/C (28.13.01) KD2* is visible for this vehicle. If this is the case, please perform the software update described in TSB 2079690.



### NOTICE

**The software update described in TSB 2079690 will be released in stages for the individual vehicle models/markets, depending on availability.**

## Warranty

Replacing parts will not fix the problem. If parts are replaced without good reason, they will be charged back.

|                          |                                                                                                                                                   |
|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Claim Type:</b>       | <ul style="list-style-type: none"><li>If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li></ul> |
| <b>Service Number:</b>   | 9710                                                                                                                                              |
| <b>Damage Code:</b>      | KD02                                                                                                                                              |
| <b>Labor Operations:</b> | Please use the accounting instructions and labor times specified in TSB 2079690, <i>00 Combined software update 03.10.00/C (28.13.01) KD2</i> .   |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## **Additional Information**

All part and service references provided in this TSB (**2079729**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©**2025 Audi of America, Inc.** All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.