

Audi On-car analysis list from November 1, 2025

Please contact Audi Helpline before attempting repair

Please see TSB 2066297 '00 VIN-4-PIN reporting program (V4P, vin4pin) for more info about the program

	Models	MY	Engine	Trans	Topic	Topic details
	A6, A7, A8, Q7, Q8	2019-2025	any	Any	P1B1B00 wear limit of main protection reached	Photos of the warning message and light in the cluster. GFF LOG showing the DTC stored ACTIVE/STATIC and the test plan for this DTC and other related 48V DTC's performed uploaded to paperless. Date and time of the customer's concern documented in the TAC ticket. On site analysis needed. Contact TAC for further instruction
	Q5 (GU)	2025	2.0L	Any	P001700: Crankshaft Position-Camshaft Position Correlation Bank 1 Sensor B	1.Verify P001700: Crankshaft Position-Camshaft Position Correlation Bank 1 Sensor B 2.Please open TAC ticket for possible onsite.
	A3	2022-2025	any	Any	48V Battery Cooling Fan – P0A8200	Diagnostic LOG uploaded to paperless showing DTC "P0A8200" in DA0021 Pictures during work instructions provided by TAC
	A6, A7, A8, Q7, Q8	2023-2025	any	Any	B&O extendable tweeter	For B&O audio system with extendable/retractable tweeters in dash Tweeter gets stuck or shutters during operation Take a short video duplicating concern Fully extend the tweeter manually, cycle key. Is function restored? Does output diagnosis work correctly? Clear faults and re-evaluate WEB TAC case with documentation provided.
	e-tron quattro	2019-2023	any	Any	drive-motor coolant and gear oil cross contamination	•Photos of the coolant reservoir or coolant collected from the front drive motor •Photos of the gearbox fluid sample (in a white cup at a 45°) •Photos of any debris collected from the gearbox •Could you verify the customer concern? •Have there been any prior repairs to the drive motor or gearbox? If there are prior repairs to the drive motor this document can be disregarded.
	A5, Q5, A6 e-tron, Q6 (FU, GU, GH, GF)	2025	any	Any	PPE - PPC vehicles time is off by 1 hour	Photo of time in cluster, time settings in MMI, another phone with navigation location and time all in one photo • Read all MVB's from Da0075 while issue is NOT present • Read all MVB's from Da0075 when issue is actively occurring (document the log ID to correspond) • Provide specific location information as to where and how the duplicate • Can this be duplicated on other vehicles? • Is the area of concern close to another time zone? • Please provide an address or GPS location of the area in which the concern happens