



Connection offline

Technical Service Bulletin

Transaction No.: **2080076/1**

97 Engine warning lamp on, DTC "P157000 Engine Control Module (ECM) locked" is logged in the ECM

Release date: Nov 20, 2025

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A5 Coupe, S5 Coupe (FU), Q5, Q5 Sportback, SQ5, and SQ5 Sportback (GU)	2025	All	Software Version: 1436 1437 1496

Customer states:

The customer statement depends on the type of engine:

Vehicles with 2.0 ltr. gasoline engine:

- The engine does not start at the first attempt.
- Several driver messages appear in the instrument cluster.
- After switching the ignition off and on, the engine starts again and there are no further issues.

All other engines:

- Several driver messages appear in the instrument cluster after starting the vehicle.
- The vehicle can only be driven electrically; the engine does not start.
- After switching the ignition off and on, the engine starts again and there are no further issues.

Workshop findings:

The customer complaint cannot usually be reproduced.

The following DTC is logged in the Engine Electronics -J623-, (address word: 0001):

- **P157000:** "Engine Control Module (ECM) locked."

Technical Background

Software issue the in onboard supply control unit J519 (diagnostic address 0009).

Production Solution

Production change in Q4 of 2025.

Service

This TSB only applies if:

1. The DTC **"P157000 Engine Control Module (ECM) locked"** is logged in the engine control module (diagnostic address 0001).
2. The DTC **"Transmission control module locked"** is **NOT** logged in the transmission control module (diagnostic address 0002).

Please check whether TSB 2079690, *00 Combined software update 03.10.00/C (28.13.01) KD2* is visible for this vehicle. If this is the case, please perform the software update described in **TSB 2079690**.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9710		
Damage Code:	KD02		
Labor Operations:	Software update, including connecting battery charger	0151 0010	See SRT with associated operations
	Fixed rate for software update, including all required preliminary and follow-up work (including bus sleep cycle, calibration drive, additional work and restarting software update if flashing is aborted)	0151 0040	130 TU
Claim Comment:	As per TSB 2080076/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

When performing the combined software update, time stamps are not required for billing under warranty. You are therefore permitted to work on other vehicles at the same time. The combined software update can also be performed by non-productive personnel.

Additional Information

All part and service references provided in this TSB (**2080076**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2025 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.