

Technical Service Bulletin (TSB)

Clutch Switch Failure

REFERENCE:	TSB: 08-393-25 GROUP: 08 - Electrical	Date:	December 4, 2025	REVISION:	–
VEHICLES AFFECTED:	2025 (JL) Jeep Wrangler This bulletin applies to vehicles equipped with 6-Speed Manual Transmission (Sales Code DEM).			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☐ EE☐ CH NOTE: This bulletin applies to North America market.	
CUSTOMER SYMPTOM:	Customers must experience a Malfunction Indicator Lamp (MIL) illumination and the vehicle must set the following Diagnostic Trouble Code (DTC): - P083F - Clutch Pedal Switch A/B Correlation. Customers may also experience the following: - Vehicle no start. - Vehicle stop/start disabled.				
CAUSE:	Clutch interlock switch electrical terminal corrosion				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-247, date of issue December 04, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting the clutch interlock switch and possibly replacing the clutch interlock switch.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-80-59-91	Switch, Clutch Starter Interlock- Inspect (1 - Semi Skilled)	6 - Electrical and Body Systems	0.2 Hrs.
08-80-59-92	Switch, Clutch Starter Interlock- Inspect and Replace (1 - Semi Skilled)	6 - Electrical and Body Systems	0.4 Hrs.
Failure Code	ZY	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	68029261AA	Switch, Clutch Starter Interlock	

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customers VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure. **This bulletin applies only to vehicles on the RSU VIN list.**

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	–	–

REPAIR PROCEDURE:

1. Is the vehicle on the RSU VIN list?
 - YES>> Proceed to [Step 2](#).
 - NO>>> This bulletin does not apply.
2. Remove the clutch interlock switch connector and inspect the electrical terminals [Fig. 1](#) for pitting/ corrosion.

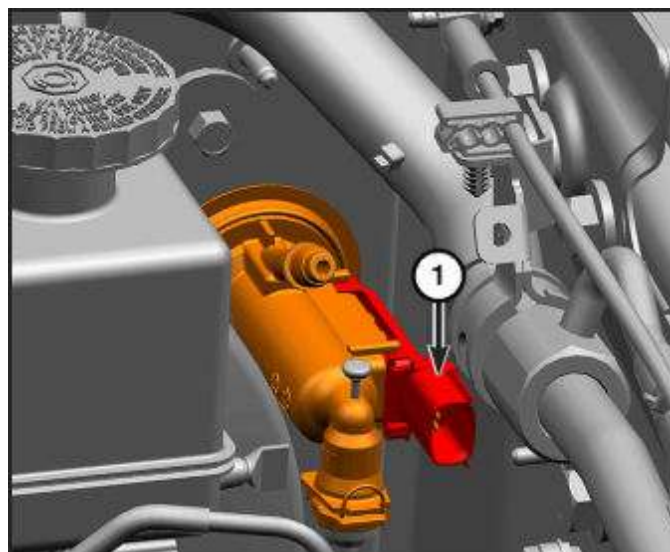


Fig. 1
Clutch Starter Interlock Switch

3. Is the connector pitted and/or otherwise corroded?
 - YES>>> Proceed to [Step 4](#).
 - NO>>> This bulletin has been completed. Use Inspection LOP (08-80-59-91) to close the active RSU.
4. Replace the Clutch Interlock Switch. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 06 - Clutch / Switch, Clutch Starter Interlock / Removal and Installation.
5. Clean the clutch interlock switch electrical connector terminals using electrical contact cleaner and compressed air to remove any corrosion present.
6. Using wiTECH perform the Clutch Pedal Position Learn Procedure. This can be found under PCM > Misc. Functions tab.
7. Clear all DTC's before returning vehicle to customer.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.