

Reference	SSM71849
Models	LR4 / L319 Range Rover Sport / L320
Title	AMK Suspension Compressor Replacement
Category	Chassis
Last modified	18-Jun-2014 00:00:00
Symptom	304000 Suspension System
Content	<u>Issue:</u> A customer may complain that either "Vehicle Raising In Progress" or "Suspension Will Rise When System Is Cooled" messages can be seen. Fault codes U210A - 16 and C1A24 - 67 may also be stored. <u>Cause:</u> Internal fault within the thermistor wiring harness of the air suspension compressor. <u>Action:</u> Before replacing the compressor, please check the thermistor wiring harness LR060166 via SDD by gently moving the harness up and down. If the harness is faulty SDD will show a change in the temperature reading and in some cases a change in stored fault codes U210A - 16 and C1A24 - 67. This concern has now been rectified from VIN LA690555 for Discovery 4/LR4 and VIN LS775963 for Range Rover Sport. Note: Thermistor Harness LR060166 is now available and can be found in Microcat. SRO 86.71.25 - Time = 0.50 hours. Refer to TOPIx Section 418-02 Wiring Harnesses, Suspension Air Supply Unit Wiring Harness. NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.