

# Technical Bulletin

---

| Model(s)      | Year(s) | Eng. Code(s) | Trans. Code(s) | VIN Range From | VIN Range To |
|---------------|---------|--------------|----------------|----------------|--------------|
| Jetta<br>(A6) | 2011    | 2.0L<br>CBPA | Manual         | All            | All          |

## Condition

01 13 22 July 31, 2013 2026529 Supersedes T. B. V011205 dated February 27, 2012 to update the SVM action code in SVM table.

### Update Programming to Eliminate DTC P050A Stored in ECM Fault Memory

| DTC   | Description                                    |
|-------|------------------------------------------------|
| P050A | Cold Start Idle Air Control System Performance |

## Technical Background

Customers may complain of a MIL ON condition, which is caused by DTC P050A.

**DO NOT** replace any parts for this condition.

The condition as described **does not** affect vehicle performance or operation.

## Production Solution

Improved software was introduced in production.

# Technical Bulletin

## Service

### Update Programming Procedure:



**Tip:**

To Update-Programming using SVM, **review and follow** instructions in **Technical Bulletin Instance 2014603** "Software Version Management".

The SVM Process must be completed in its entirety so the database receives the update confirmation response. A warranty claim may not be reimbursed if there is no confirmation response to support the claim.



**Note:**

Prior to launching the VAS-PC and ODIS service diagnostic applications and starting control module update process, confirm tester screen saver and power settings in accordance with Special Tools and Equipment - Service Information Circular # VVT-12-02. Failure to do so may result in the tester entering power save mode during data transfer, and subsequent control module failure.

When using a VAS 6150/5051B or VAS 5052A tester in conjunction with a VAS 5054A wireless transmitter head for a flash procedure, please connect a USB cable between the transmitter head and the tester. Failure to do so may lead to errors during the flash procedure.

VAS tools must only be used with their power adapters plugged in. Under no circumstances should they be used on battery power alone during the programming procedure.

**Critical Warning:** The Midtronics Battery Charger **must** be connected to the vehicle battery for the duration of the programming, to ensure the battery state of charge remains above 12.5 volts during the update process. If the battery drops below 12.5 volts, the programming could fail which may result in damage to the control module. Control modules damaged by inadequate voltage will not be covered under the warranty policy. The technician should verify the vehicle voltage prior to starting the update process, and should monitor the voltage for the duration of the update.

- Update the Engine Control Module using the SVM action code as listed in the table below:

| Model         | Engine         | Old Software Part No. | Old Software Version | New Software Part No. New | Software Version (or higher) | SVM Action Code |
|---------------|----------------|-----------------------|----------------------|---------------------------|------------------------------|-----------------|
| Jetta<br>(A6) | 2.0L<br>(CBPA) | 06G 906 055 B         | All                  | 06G 906 055 B             | 1109                         | 3801            |
|               |                | 06G 906 055 C         |                      | 06G 906 055 C             | 1108                         |                 |

# Technical Bulletin

---

The procedure can be found in GFF under Functions/ Component Selection, Software Version Management, Adapting Software.



## **WARNING:**

Radiator Fan(s) may cycle ON high speed during the Update Process! There is a risk that personal injury may result if contact is made with spinning fan blades.

Keep hands and all objects away from Radiator Fan(s) during Update Process!



## **Tip:**

The SVM Process must be completed in its entirety so the database receives the update confirmation response. A warranty claim may not be reimbursed if there is no confirmation response to support the claim or action is carried out that is not explicitly stated in the Technical Bulletin.

Ensure attached ECM/TCM Tuning Form has been completed and signed by customer as required in SVM Technical Bulletin Instance 2014603.

# Technical Bulletin

## Warranty

| To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual <sup>1)</sup>                                                                                                                                                                                                    |                                      |              |                                                |                   |              |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------|--------------|------------------------------------------------|-------------------|--------------|
| Model(s)                                                                                                                                                                                                                                                                                                                               | Year(s)                              | Eng. Code(s) | Trans. Code(s)                                 | VIN Range From    | VIN Range To |
| Jetta<br>(A6)                                                                                                                                                                                                                                                                                                                          | 2011                                 | 2.0L<br>CBPA | Manual                                         | All               | All          |
| Claim Type:                                                                                                                                                                                                                                                                                                                            |                                      |              | Use applicable Claim Type <sup>1)</sup>        |                   |              |
| SAGA Coding                                                                                                                                                                                                                                                                                                                            |                                      |              |                                                |                   |              |
| Service Number:                                                                                                                                                                                                                                                                                                                        | Damage Code                          | HST          | Damage Location<br>(Depends on Service No.)    |                   |              |
| 2470                                                                                                                                                                                                                                                                                                                                   | 0039                                 | --           | Use applicable when indicated in ElsaWeb (L/R) |                   |              |
| Parts Manufacturer                                                                                                                                                                                                                                                                                                                     | Jetta                                |              |                                                | 3ME <sup>2)</sup> |              |
| Labor Operation <sup>3)</sup> : Update Programming                                                                                                                                                                                                                                                                                     |                                      |              | 24702599 = 30 TU                               |                   |              |
| Labor Operation <sup>3)</sup> : Charge Battery                                                                                                                                                                                                                                                                                         |                                      |              | 27068950 = 10 TU                               |                   |              |
| Causal Part: Select Labor Operation                                                                                                                                                                                                                                                                                                    |                                      |              | 24702599                                       |                   |              |
| Diagnostic Time <sup>4)</sup>                                                                                                                                                                                                                                                                                                          |                                      |              |                                                |                   |              |
| GFF Time expenditure                                                                                                                                                                                                                                                                                                                   | 01500000 = 30 TU max.                |              |                                                | YES               |              |
| Road Test                                                                                                                                                                                                                                                                                                                              | 01210002 = 00 TU<br>01210004 = 00 TU |              |                                                | NO                |              |
| Technical Diagnosis                                                                                                                                                                                                                                                                                                                    | 01320000 = 00 TU max.                |              |                                                | NO                |              |
| Claim Comment: Input "As per Technical Bulletin 2026529" in comment section of Warranty Claim.                                                                                                                                                                                                                                         |                                      |              |                                                |                   |              |
| <sup>1)</sup> Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only<br><sup>2)</sup> Code per warranty vendor code policy.<br><sup>3)</sup> Labor Time Units (TUs) are subject to change with ELSA updates.<br><sup>4)</sup> Documentation required per Warranty Policy & Procedures Manual. |                                      |              |                                                |                   |              |

# Technical Bulletin

---

## Required Parts and Tools

No Special Parts required.

| Tool Description                  | Tool No:                                                                                                                                           |
|-----------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|
| Midtronics Battery Tester/Charger | InCharge 940 (INC-940)                                                                                                                             |
| VAS Diagnostic Tool               | VAS 5051B, VAS 5052A, VAS 6150/X & VAS 6160/-VPC with:<br>VAS-PC Base V19.01.01 and current version<br>Brand disc<br>ODIS Service V1.1.3 or higher |

## Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.



## OWNER INFORMATION ABOUT CONTROL MODULE TUNING\* ACKNOWLEDGEMENT AND AUTHORIZATION FOR REPROGRAMMING (REFLASHING) OF CONTROL MODULE(S)

 
\*) "TUNING" is described as the addition of or modification of any component which causes a Volkswagen vehicle to perform outside the normal parameters and specifications approved by Volkswagen Group of America / Volkswagen Group Canada.

Date: \_\_\_\_\_

Dealer Number: \_\_\_\_\_

Vehicle Identification Number: \_\_\_\_\_

Repair Order Number: \_\_\_\_\_



Dealer stamp

I \_\_\_\_\_, owner or driver of the above identified Volkswagen, confirm:

☐ "Tuning" as described above (especially power increasing modifications) has NOT been performed on my vehicle.

☐ "Tuning" as described above has been performed on my vehicle and the following components were modified or installed:

\_\_\_\_\_  
TUNING was performed by (Please provide Company name and telephone number, if you wish us to contact them):

I understand that if my Control Module is determined to have been tuned, any damage caused by the tuning of the Control Module (including adverse emissions consequences) will not be covered by VWGoA / VGC warranties.

I am permitting an authorized Volkswagen Dealer to reflash (update) my Control Module, and by doing so, I understand that this process will automatically overwrite (destroy) and permanently delete any tuning program that was previously installed on the Control Module of my Volkswagen vehicle.

By signing below, I fully acknowledge and understand that the tuning program will not be restored and VWGoA / VGC, will not be liable in any way for the loss of tuning data.

\_\_\_\_\_  
Signature of Customer