

Technical Service Bulletin (TSB)

Flash: Hybrid Control Processor (HCP) and Auxiliary Hybrid Control Processor (AHCP) Updates

REFERENCE:	TSB: 08-212-25 REV. A GROUP: 08 - Electrical	Date:	August 30, 2025	REVISION:	08-212-25
VEHICLES AFFECTED:	2025 (JL) Jeep Wrangler This bulletin applies to vehicles built on or before May 19, 2025 (MDH 0519XX) equipped with a 2.0L I4 DOHC DI Turbo PHEV Engine (Sales Code ECX).			MARKET APPLICABILITY: ☒ NA☒ MEA ☒ SA☒ IAP ☒ EE☒ CH NOTE: This bulletin applies to North and South America, Enlarged Europe, Middle East & Africa, India & Asia Pacific and China markets.	
CUSTOMER SYMPTOM:	Customers must experience a Malfunction Indicator Lamp (MIL) illumination and the vehicle must exhibit/set one or more of the following Diagnostic Trouble Codes (DTCs): ● P0BBD - Hybrid Battery Pack Voltage Variation Exceeded Limit. ● P0B24 - Hybrid Battery 'A' Voltage Unstable. ● P1CEA - Boost Side Evap Purge System Performance ● P04B5 - Fuel Fill Door Stuck Open. Customers may experience one or more of the following: ● Vehicle Will Not start/shift out of park. ● Service Charging System message. ● Battery degradation. ● Reduced fuel efficiency. ● Rough idling or engine misfires. ● Inconsistent or erratic performance. ● Warning lights on the dashboard (e.g., hybrid system warning light).				
CAUSE:	HCP/AHCP module software updates				

This bulletin supersedes Technical Service Bulletin (TSB) 08-212-25, date of issue July 11, 2025, which should be removed from your files. All revisions are highlighted with **asterisks**** and include converting the TSB to an RSU, updated Repair Summary, new LOPs, updated Claims Data Failure Code and statement, updated Diagnosis statement, additional Repair Procedure steps and a new Repair Procedure note.**

****This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-183, date of issue August 30, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.****

REPAIR SUMMARY:

This bulletin involves inspecting the HCP/AHCP, also known as Power Inverter Module (PIM) software level and possibly reprogramming the HCP/AHCP and the PCM to the latest available software.**

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
**18-19-86-BG	Inspect HCP/ACHP Module Software Level (0 - Introduction)	1 - Engine Repair And Performance	0.2 Hrs.
18-19-86-BH	Inspect and Reprogram HCP/ACHP Module Software (Includes Contactor Routine) (0 - Introduction)	1 - Engine Repair And Performance	0.6 Hrs.
Failure Code	RF	Required Flash - RSU**	
	CC	Customer Concern	

****The dealer must choose which failure code to use depending on if this is a Rapid Service Update (RSU) or Technical Service Bulletin.**

- The “RF” failure code is required for essential module flash/reprogramming and can only be used after confirmation that the VIN is included on the RSU.
- The failure code “RF” (Required Flash) can no longer be used on Technical Service Bulletin flashes. The “RF” failure code must be used on an RSU.
- If the customer’s concern matches the SYMPTOM/CONDITION identified in the Technical Service Bulletin, failure code CC is to be used. When utilizing this failure code, the 3C’s must be supplied.**

RELATED LOPS:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-00-02-51	High Voltage Power Down, Power Up, and Isolation Tes (1 - Semi Skilled)	6 - Electrical and Body Systems	0.6 Hrs.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

****If a customer’s VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.****

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	–	–

REPAIR PROCEDURE:**WARNING!**

- Before performing the software reprogramming, it is necessary to make the vehicle safe.
- When performing repairs that directly involve or imply possible contact with live high voltage components/systems, the technician must ensure that the power supply of the high-voltage system is disconnected throughout the operation.
- Only specifically trained technicians qualified to perform repairs on vehicles with high voltage systems under current national laws/regulations are authorized to work on the vehicle.
- Before performing any diagnostic repair work on the vehicle, carefully read and comply with the general instructions for working safely on hybrid/electric vehicles and use suitable general equipment and Personal Protective Equipment (PPE).

NOTE: The vehicle must not be connected to a high voltage charger when performing software updates.

NOTE: Install a battery charger to ensure sufficient battery voltage is provided during the flash process.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

NOTE: ****The Powertrain Control Module (PCM) must be updated to the latest available software at the conclusion of this repair procedure. Refer to all applicable published service bulletins for detailed repair procedures and labor times regarding updating the PCM software.****

1. ****Is the vehicle on the RSU VIN list?**
 - YES >>> Proceed to [Step 2](#).
 - NO >>> Proceed to [Step 3](#).
2. Inspect the HCP/AHCP software level.
3. Is the HCP/AHCP updated to the latest software level?
 - YES >>> This bulletin is complete. Use Inspect LOP (18-19-86-BG) to close this active RSU.
 - NO >>> Proceed to [Step 4](#).******
4. Disable HV Battery Contactors using wiTECH - Go to the Misc Functions tab --> Select Disable HV Battery Contactors --> then follow the wiTECH prompts.
5. Use wiTECH to confirm that the contactors are open and waiting five minutes. If the contactors do not open turn the ignition on then off. Once successful a note will appear on the wiTECH screen indicating the contactors are open.
6. Reprogram the AHCP and then the HCP with the latest software. If issues arise when flashing a module using the wiTECH Diagnostic Application, please submit a ticket to the Helpdesk. The helpdesk can be found within the Help menu.
7. ****Power down the HV battery system. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 12 - Electrified Powertrain System / High Voltage Battery / Standard Procedure.**
8. Power up the HV battery system. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 12 - Electrified Powertrain System / High Voltage Battery / Standard Procedure.******

9. Verify the PCM is programmed with the latest available software. Refer to all applicable published service bulletins for detailed repair procedures and labor times regarding updating the PCM software.**
10. Enable HV Battery Contactors using wiTECH - Go to the Misc Functions tab --> Select Enable HV Battery Contactors For Service--> then follow the wiTECH prompts.
11. Clear any DTCs that may have been set in any modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

NOTE: For SA market only, after applying this TSB, it is not necessary to send DID-I or DID-A.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.