



SSM 54232 2025 Mustang GTD - Various Suspension Warning Messages Displayed In The IPC - Built On Or Before 15-Jul-2025

Some 2025 Mustang GTD vehicles built on or before 15-Jul-2025 may exhibit various suspension warning messages displayed in the instrument panel cluster (IPC) including but not limited to "Front Lift Not Available See Manual". The vehicle may also have diagnostic trouble code (DTC) C1041:92 stored in the vehicle dynamics control module (VDM). This may be due to the VDM software. To correct the condition, reprogram the VDM module using the latest software level of the Ford Diagnosis and Repair System (FDRS) scan tool. For claiming, use causal part 18B008 and labor operations 12651D and 12651D4.