

Technical Service Bulletin (TSB)

Flash: Adaptive Cruise Control (ACC) Module Updates

REFERENCE:	TSB: 08-154-26 GROUP: 08 - Electrical	Date:	April 16, 2026	REVISION:	08-159-24 REV. A
VEHICLES AFFECTED:	2025 (M1) Jeep Compass This bulletin applies to vehicles **equipped with Adaptive Cruise Control W/Stop & Go (Sales Code NZH).**			MARKET APPLICABILITY: ☐ NA☐ MEA ☒ SA☐ IAP ☐ EE☐ CH NOTE: **This bulletin applies to the South America market.**	
CUSTOMER SYMPTOM:	**Customers must experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the technician must find the following Diagnostic Trouble Code (DTC) has been set: - C14A4-00 - Sensor Adjustment Required.** Customers may comment on one or more of the following: ***"ACC/FCW Unavailable, Service Required" message in the Instrument Panel Cluster (IPC).** - Indication of sharp curve when changing lanes without activating the turn signal. - Advanced Driver Assistance Systems (ADAS) disabled when changing lanes without activating the turn signal.				
CAUSE:	**ACC software**				

This bulletin supersedes Technical Service Bulletin (TSB) 08-159-24 REV. A, date of issue July 18, 2024, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include converting the bulletin to a TSB, a new Market Applicability Note, Sales Code, Customer Symptom statement, DTC, Customer Symptom, Cause, Repair Summary, Claims Data table, Diagnosis statement, Repair Procedure Note and updated Repair Procedure. Revisions not highlighted with asterisks include removal of the build dates and Spar Parts table.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 24-103, date of issue July 11, 2024. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

****This bulletin involves reprogramming the ACC with the latest available software.****

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
**18-80-95-AC	Module, Adaptive Cruise Control - Reprogram (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
Failure Code	CC	Customer Concern	

The dealer must use failure code CC with this Technical Service Bulletin.

- If the customer's concern matches the SYMPTOM identified in the Technical Service Bulletin, failure code CC is to be used.
- When utilizing this failure code, the 3C's (customer's concern, cause and correction) must be provided for processing Technical Service Bulletin flash/reprogramming conditions.**

DIAGNOSIS:

**Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition above, perform the repair procedure.**

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	—	—

REPAIR PROCEDURE:

NOTE: Install a battery charger to maintain a 12 volt system voltage.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. **Reprogram the ACC with the latest software. If issues arise when flashing a module using the wiTECH Diagnostic Application, please submit a ticket to the Helpdesk. The helpdesk can be found within the Help menu.
2. Clear all DTCs that may have been set in any module due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.
3. Navigate to the ACC module "ECU view".
4. Select the "Misc Functions" menu.
5. Select the "ACC DASM Drive Calibration" procedure and follow the prompts provided in the diagnostic scan tool.

NOTE: After applying this TSB, it is not necessary to send DID-I or DID-A.**

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.