

Technical Service Bulletin (TSB)

Steering Column Control Module (SCCM) Upcoming Updates

REFERENCE:	TSB: 08-164-26 GROUP: 08 - Electrical	Date:	April 18, 2026	REVISION:	—
VEHICLES AFFECTED:	2024 - 2026 (KM) Jeep Cherokee/Wagoneer S			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☐ EE☐ CH NOTE: This bulletin applies to the North America market.	
CUSTOMER SYMPTOM:	Technicians may find one or more of the following Diagnostic Trouble Codes (DTCs): - B2225-29 - Steering Column Module Internal - Signal Invalid. (Stored Status) - U0002-00 - CAN C Bus Off Performance. (Stored Status) NOTE: There will not be a Malfunction Indicator Lamp (MIL) set for these DTCs.				
CAUSE:	SCCM Software				

DISCUSSION:

This Information Only bulletin provides information if DTCs B2225-29 or U0002-00 are stored and there are no complaints of SCCM functionality (windshield wipers activating randomly). **Do not replace the SCCM.** These DTCs are triggering due to a software bug when there are transient (~40 ms) low voltage events.

NOTE: No action required, an upcoming software update will be available in 3rd quarter of 2026.

POLICY:

Information Only.