



TECHNICAL SERVICE BULLETIN

Classification:

EC26-009

Reference:

NTB26-017

Date:

April 9, 2026

ENGINE NO START WITH KEY SYSTEM ERROR AND DTC B2C20-24 STORED IN THE BCM

APPLIED VEHICLES: 2025 Murano (Z53)

IF YOU CONFIRM

The customer states the engine will not start and “Key System Error” warning is displaying in the Information Display (Combination Meter) (Figure 1),

AND

DTC B2C20-24 for "STARTER CONTROL RELAY" is stored in the BCM.

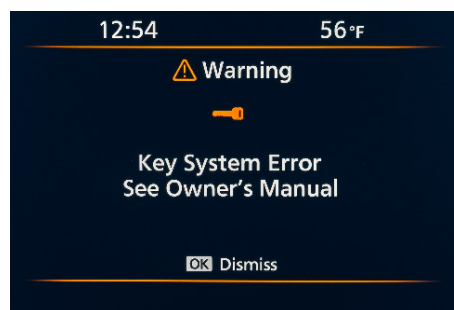


Figure 1

HINT: This DTC and warning message (Figure 1) may occur if the customer does not place the vehicle in Park Gear according to the Owner's Manual for shifter operation.

ACTION

1. Confirm the current ECM part number.
2. Confirm the current TCM part number.
3. Reprogram the ECM, and then the TCM, if applicable.
4. Erase the DTCs.

IMPORTANT: The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire **SERVICE PROCEDURE** as it contains information that is essential to successfully completing this repair.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

- Using CONSULT 4, confirm the current ECM and TCM part numbers and write them on the repair order.
 - If both the ECM and TCM numbers match the part numbers in **Table A**, continue to step 2 below.
 - If both the ECM and TCM numbers do not match the part numbers in **Table A**, this bulletin does not apply. Go back to ASIST for further diagnostic and repair information.

Table A

MODEL	CURRENT ECM PART NUMBER: 23761 -	CURRENT TCM PART NUMBER: 31039 -
2025 Murano	7BL3B, 7BL4B	7BA2A, 7BA2C

WARNING **CAUTION** **NOTICE**

If you are not familiar with the CONSULT Reprogramming procedure, refer to the CONSULT Operation Manual and the Electronic Service Manual (ESM) for steps to reprogram an Electronic Control Unit (ECU). Follow all precautions in both manuals to prevent possible personal injury or death and/or damage to the ECU.

- Reprogram the ECM, and then reprogram the TCM.

IMPORTANT: When using CONSULT 4, follow the “Vehicle Menu” and select the **Vehicle reprogramming** option under “Tool Menu” to reprogram the ECU.

HINT: When the “perform idle air volume learning” screen appears during “After ECU data writing”, select **END** to skip.

- After erasing all DTCs, print a copy of the CONSULT screen showing the before and after part numbers of the control units and attach it to the repair order.

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Reprogram ECM & TCM	(1)	RXL3AA	ZE	32	0.9

- Reference the electronic parts catalog and use the TCM (310F6-*****) as the Primary Failed Part (**PFP**).

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
April 9, 2026	NTB26-017	Original bulletin published