



SSM 54803 2024 F-150 Lightning, 2025 Mustang Mach-E - Flashing A/C Button With Lack Of Heat And/Or A/C With DTC B1717:06 Stored In The HPVCM

Some 2025 Mustang Mach-E vehicles built on or before 30-Jun-2025 and 2024 F-150 Lightning vehicles may exhibit a flashing light on the air conditioning (A/C) button with a lack of heat and/or A/C with diagnostic trouble code (DTC) B1717:06 stored in the heat pump valve control module (HPVCM). This may be due to the software in the HPVCM. To correct the condition, reprogram the HPVCM using the latest software level of the Ford Diagnosis and Repair System (FDRS). If the DTC remains this may be due to the "Heat Pump Vacuum Lock Release Sequence" application performance in the Ford Diagnosis and Repair System (FDRS). The "Heat Pump Vacuum Lock Release Sequence" application has been updated in FDRS to operate properly. For claiming, use causal part 14H266 and labor operations 12651D and 12651D4.