

ATTENTION:

GENERAL MANAGER ☐
 PARTS MANAGER ☐
 CLAIMS PERSONNEL ☐
 SERVICE MANAGER ☐

IMPORTANT - All
 Service Personnel
 Should Read and
 Initial in the boxes
 provided, right.

© 2026 Subaru of America, Inc. All rights reserved.



SUBARU

QUALITY DRIVEN® SERVICE

SERVICE INFORMATION BULLETIN

APPLICABILITY: 2016-25MY Legacy & Outback
 2016-Current Impreza & Crosstrek
 2016-Current Forester
 2017-Current WRX
 2022-Current BRZ
 2019-Current Ascent

NUMBER: 18-230-26

DATE: 05/01/26

SUBJECT: DTC B1571 and B1572 Diagnostic / Service Manual Correction

INTRODUCTION:

This service information bulletin announces the diagnostic procedures to be used when DTCs B1571(REFERENCE CODE INCOMPATIBILITY IMMOBILIZER CM TO ECM) and B1572(IMM CIRCUIT EXCEPT ANTENNA CIRCUIT) are detected by Keyless Access with Push Button Start(KACM). If the DTCs listed above are detected by the Keyless Access with Push Button, follow the service procedure outlined below. This correction will be applied to the Service Manual in the future.

SERVICE PROCEDURE / INFORMATION:

REMINDER: Customer satisfaction and retention starts with performing quality repairs.

For **DTC B1571**, the green-highlighted portions indicate newly added content in the step titled *Replace ECM*.

2. REPLACE ECM.

NOTE: Disconnect the DCM connector when installing ECM with the different VIN, otherwise the collation work is not completed and the DCM becomes unusable.

1. Install the ECM from other normal operating vehicle (with push button start) which use same ECM to the vehicle to be diagnosed. Refer to FUEL INJECTION (FUEL SYSTEMS)(H4DO(EXCEPT FOR HEV))>Engine Control Module (ECM)>REMOVAL.
2. Perform ECM registration. Refer to the "REGISTRATION MANUAL FOR IMMOBILIZER" provided as a separate volume.

Is ECM registration finished? And does the engine start?

Yes

Replace the ECM. Ref. to FUEL INJECTION (FUEL SYSTEMS)(H4DOTC)>Engine Control Module (ECM) Install the ECM from other vehicle to the original vehicle and reconnect the DCM.

No

Replace the keyless access CM (model without ID code box) Ref. to SECURITY AND LOCKS>Keyless Access CM or the ID code box (model with ID code box). Ref to SECURITY AND LOCKS>ID Code Box and reconnect the DCM.

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Subaru of America, Inc. is ISO 14001 Compliant

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Continued...

For **DTC B1572**, the green-highlighted portions indicate newly added content in the step titled *Check ECM*.

4. **CHECK ECM**

NOTE: Disconnect the DCM connector when installing ECM with the different VIN, otherwise the collation work is not completed and the DCM becomes unusable.

1. Install the ECM from other normal operating vehicle (with push button start) which use same ECM to the vehicle to be diagnosed.
2. Perform ECM registration. Refer to the "REGISTRATION MANUAL FOR IMMOBILIZER" provided as a separate volume. Refer to FUEL INJECTION (FUEL SYSTEMS)(H4DO(EXCEPT FOR HEV))>Engine Control Module (ECM)>REMOVAL.

Is ECM registration finished? And does the engine start?

Yes

Replace the ECM. Ref. to FUEL INJECTION (FUEL SYSTEMS)(H4DOTC)>Engine Control Module (ECM) Install the ECM from other vehicle to the original vehicle and reconnect the DCM connector.

No



Reconnect the DCM connector and Go to 5.

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.