



# Service Bulletin

Bulletin No.: PIT6218D

Date: July, 2026

## PRELIMINARY INFORMATION

**Subject:** SES light P059F

| Brand:    | Model:             | Model Year: |    | VIN: |     | Engine: | Transmission: |
|-----------|--------------------|-------------|----|------|-----|---------|---------------|
|           |                    | from        | to | from | to  |         |               |
| Buick     | Enclave            | 2025-2026   |    | All  | All | All     | All           |
| Chevrolet | Traverse (All New) | 2024 - 2026 |    | All  | All | LK0     | All           |
| GMC       | Acadia             | 2024 - 2026 |    | All  | All | All     | All           |

|                                   |                                                                        |
|-----------------------------------|------------------------------------------------------------------------|
| <b>Involved Region or Country</b> | North America                                                          |
| <b>Condition</b>                  | SES light on with code P059F set for active grill shutter malfunction. |
| <b>Cause</b>                      | Possible bent hood support front bumper bracket.                       |

### Correction

Before replacing the grill shutter inspect the bracket in front of it for being bent as shown below.



6719668



6719669

If the bracket is bent, remove the bracket and command the shutter with GDS2.

If the shutter will move when commanded replace the bracket.

See the photo below of a good bracket for comparison.



6719671

If the bracket is not bent follow SI diagnostics for the code.

**Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation                                         | Description                        | Labor Time |
|---------------------------------------------------------|------------------------------------|------------|
| * 2087078                                               | Bent Bracket Replacement for P059F | 1.1 Hr.    |
| *This is a unique Labor Operation for Bulletin use only |                                    |            |

|          |                                                                                                                                                                                                                                               |
|----------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Version  | 5                                                                                                                                                                                                                                             |
| Modified | 08/19/2024 - Created on.<br>01/13/2025- Updated model years.<br>03/31/20/2025- Updated to add labor operation<br>11/5/2025- Updated to add model year 2026<br>07/24/2026- Updated to remove reference to replace shutter from the correction. |

