



Service Bulletin

Bulletin No.: PIP6130

Date: August, 2026

PRELIMINARY INFORMATION

Subject: Diagnostic Tips LK0 P0299


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2026		All	All	2.5L LK0	All
Chevrolet	Traverse	2026		All	All	2.5L LK0	All
GMC	Acadia	2026		All	All	2.5L LK0	All

Involved Region or Country	North America
Condition	Some customers may comment on a SES MIL with DTC P0299 that could be intermittent.
Cause	The cause of this condition may be a misaligned turbocharger compressor housing relative to the rest of the turbocharger assembly, or a bent wastegate lever.

Correction

Verify the fuel level per bulletin 25-NA-227.

Verify the turbocharger wastegate lever is not bent. See picture below showing a bent wastegate lever.

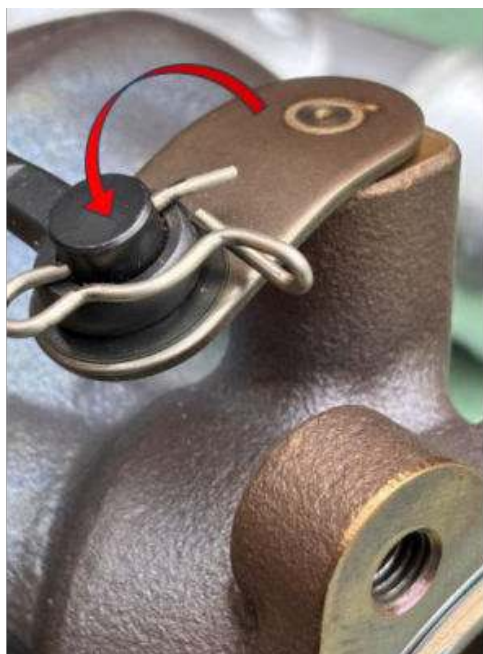

7200176

If the turbocharger wastegate lever is bent, replace the turbocharger.

If the fuel level was not low and the turbocharger wastegate lever was not bent, follow the P0299 diagnostics in Service Information.

If service information does not lead to a repair, replace the turbocharger assembly.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4068290	Compressor Air Intake Turbocharger Replacement	Use Published Time Per Application

Version	1
Modified	08/11/2026 Created on

