

## **SSM 49218: 2020 Explorer - Illuminated MIL With DTCs U0100, U0155, P166B, P0929, And/Or P0919**

Some 2020 Explorer vehicles may exhibit an illuminated malfunction indicator lamp (MIL) and diagnostic trouble codes (DTCs) U0100, U0155, P166B, P0929, and/or P0919. The vehicle may also exhibit an illuminated powertrain malfunction (wrench) indicator lamp. This may be due to the software in the gear shift module (GSM). To correct the condition, reprogram the GSM using the latest software level of the appropriate Ford diagnostic scan tool. For claiming, use causal part 7P155 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

### **Vehicles:**

|      |                       |
|------|-----------------------|
| 2020 | Explorer (U625N) (TW) |
|------|-----------------------|

### **Symptom Code:**

P0919

P0929

P166B

U0155