



GROUP
ELE

MODEL
**See Model List
on Page 1**

NUMBER
231 (Rev 1, 04/28/2021)

DATE
April 2021

TECHNICAL SERVICE BULLETIN

SUBJECT:

**FRONT VIEW CAMERA REPLACEMENT
FOR DTC C160449 & C160649**

★ NOTICE

This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This bulletin provides information on the inspection and replacement of the front camera on some vehicles listed below. Due to an internal control chip concern inside the camera, the vehicle may exhibit an MIL on with DTC C160449 and/or C160649. Certain systems may become temporarily disabled during occurrences: Smart Cruise Control (SCC), Lane Keep Assistance (LKA), Lane Departure Warning (LDW), Forward Collision-Avoidance Assist (FCA), Forward Collision Warning (FCW) and/or Driver Attention Warning (DAW). Follow the procedure outlined in this publication to diagnose and replace the front view camera assembly.

DTC Description:

C160449 – Hardware Concern

C160649 – Software Concern

Model Year	Model	Production Date Range
2020-2021	Telluride (ON)	August 7, 2018 through November 30, 2020
2019-2021	Forte (BDm)	June 1, 2018 through November 20, 2020
2017-2021	Sportage (QL)	May 19, 2015 through September 30, 2020




Front View Camera
(image is representative only)

Printed TSB copy is for reference only; information may be updated at any time.
Always refer to KGIS for the latest information.

Circulate To: ☒ General Manager ☒ Service Manager ☒ Parts Manager
☒ Service Advisors ☒ Technicians ☒ Body Shop Manager ☒ Fleet Repair

Replacement Procedure:


1. Remove and replace the Front View Camera (A) by referring to the “Body Electrical System → Front Camera System → Front View Camera Unit → Repair Procedures” chapter in the applicable Shop Manual on KGIS.

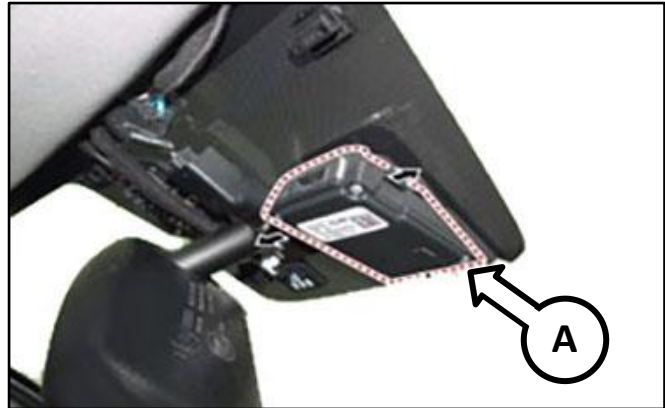

2. Perform the “Variant Coding” procedure by referring to the “Body Electrical System → Front Camera System → Repair Procedures” chapter in the applicable Shop Manual on KGIS.

❗ IMPORTANT

After replacing the front camera with a new unit, the Variant Coding procedure must be performed.

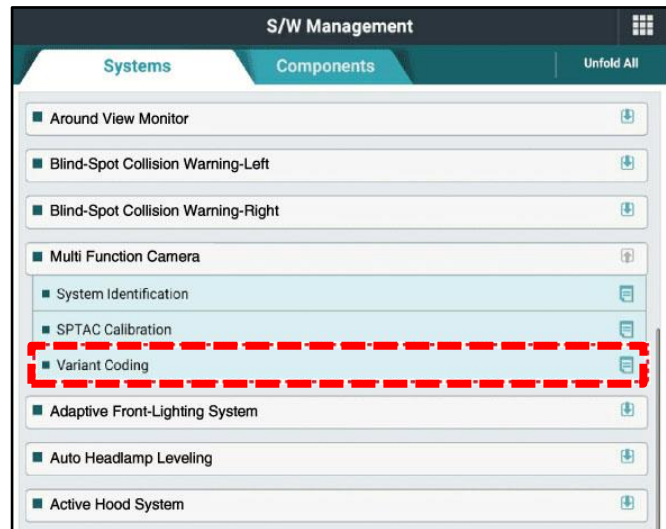

3. Perform the Calibration procedure by referring to the “Body Electrical System → Front Camera System → Repair Procedures” chapter in the applicable Shop Manual on KGIS.
4. Connect vehicle to KDS and check for DTCs.

SUBJECT: FRONT VIEW CAMERA REPLACEMENT FOR C160449 & C160649**AFFECTED VEHICLE RANGE:**

Model Year	Model	Production Date Range
2020-2021	Telluride (ON)	August 7, 2018 to November 30, 2020
2019-2021	Forte (BDm)	June 1, 2018 through November 20, 2020
2017-2021	Sportage (QL)	May 19, 2015 to September 30, 2020

REQUIRED PART:

Part Name	Model	Part Number		Figure	Qty.
		Old	New		
Front View Camera Unit	Telluride (ON)	99211 S9100	99211 S9100FFF		1
	Forte (BDm)	95740 M6000	95740 M6000FFF		
	Sportage (QL)	95895 D9100	95895 D9100FFF		
		99211 F1000	99211 F1000FFF		

Note: All parts and service references provided in this bulletin are subject to change. Always check with your local Mobis for the latest information.

WARRANTY INFORMATION:

N Code: I3A C Code: ZZ3

Model	Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
Telluride (ON)	W	Refer to EPC (Front View Camera)	0	R&R Front Camera Assy	95895F02	0.8 M/H	99211 S9100FFF	1
Forte (BDm)							95740 M6000FFF	
Sportage (QL)							95895 D9100FFF	
							99211 F1000FFF	

Note: Op time includes diagnostic tool operation & part's calibration after the part's replacement. Always use the correct causal part when submitting the warranty claim.