

Classification:

EL12-086

Reference:

ITB13-004

COPYRIGHT © NISSAN NORTH AMERICA, INC.
Date:

March 13, 2013

2013 JX35; IGNITION BUTTON WILL NOT RESPOND DURING REMOTE START USE

APPLIED VEHICLE:

2013 JX35 (L50)

APPLIED VIN AND DATE:

Built before 5N1AL0MM(*)DC 324049, Oct 01, 2012

IF YOUR CONFIRM:

During or after a "Remote Engine Start" (RES) operation:

- The ignition switch will not respond to any input.

And

- ELEC IGN relay and IPDM IGN relay may turn ON and OFF continuously, while ACC remains OFF.
- Brake and charge lamps may blink continuously.
- DTCs P2103 and U1000 may be present.

ACTION:

- Replace Body Control Module (BCM) with Part listed below in PARTS INFORMATION.

IMPORTANT: BEFORE removing the BCM refer in the appropriate ESM to M: ELECTRICAL & POWER CONTROL, BCS – Body Control System, BCM BASIC INSPECTION to begin the procedure for BCM Replacement.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
BCM	284B1-3JA1D	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

OPERATION	OP CODE	PFP	SYM	DIAG	FRT
REPLACE BCM	RX3AAA	284B1-3JA1D	ZE	32	1.0

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.