



SERVICE BULLETIN

Classification:

EL12-085a

Reference:

NTB13-023a

Date:

April 2, 2013

2013 ALTIMA AND PATHFINDER; IGNITION BUTTON WILL NOT RESPOND DURING REMOTE START USE

This bulletin has been amended to change the Claims Information.
No other changes have been made to the bulletin.

APPLIED VEHICLE VIN AND DATE:

2013 Altima (L33)
Built before 1N4AL3AP(*)DC 150330, Oct 01, 2012
Built before 1N4BL3AP(*)DN 454258, Oct 01, 2012
2013 Pathfinder (R52)
Built before 5N1AR2MM(*)DC 602921, Oct 01, 2012

IF YOUR CONFIRM:

During or after a "Remote Engine Start" (RES) operation:

- The ignition switch will not respond to any input.

And

- ELEC IGN relay and IPDM IGN relay may turn ON and OFF continuously, while ACC remains OFF.
- Brake and charge lamps may blink continuously.
- DTCs P2103 and U1000 may be present.

ACTION:

- Replace Body Control Module (BCM) with Part listed on the next page in PARTS INFORMATION.

IMPORTANT: BEFORE removing the BCM refer in the appropriate ESM to **M: ELECTRICAL & POWER CONTROL, BCS – Body Control System, BCM BASIC INSPECTION** to begin the procedure for BCM Replacement.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
BCM for Altima (L33)	284B2-3TA0C	1
BCM for Pathfinder (R52)	284B1-3JA1D	1

Altima

CLAIMS INFORMATION

Submit a Primary Part (PFP) type line claim using the following claims coding:

OPERATION	OP CODE	PFP	SYM	DIAG	FRT
REPLACE BCM	RX3AAA	284B2-3TA0C	ZE	32	1.1

Pathfinder

CLAIMS INFORMATION

Submit a Primary Part (PFP) type line claim using the following claims coding:

OPERATION	OP CODE	PFP	SYM	DIAG	FRT
REPLACE BCM	RX3AAA	284B1-3JA1D	ZE	32	1.0

