

Classification:

Reference:

COPYRIGHT © NISSAN NORTH AMERICA, INC.  
Date:

TF15-002

ITB15-014

March 17, 2015

## 2013 JX35 AND 2014 QX60 AWD ERROR DISPLAYED AND DTC C1204 STORED

|                   |                                                              |   |                   |
|-------------------|--------------------------------------------------------------|---|-------------------|
| APPLIED VEHICLES: | 2013 JX35 (L50)<br>2014 QX60 (L50)<br>2014 QX60 Hybrid (L50) | } | Equipped with AWD |
|-------------------|--------------------------------------------------------------|---|-------------------|

APPLIED VIN / DATE: Built before 5N1(\*)L0M(\*\*)EC 548571 / August 5, 2014

### IF YOU CONFIRM

The vehicle has been operated in cold weather, below approximately -18°C (0°F),

and

AWD ERROR is displayed in the Vehicle Information Display,

and

DTC C1204 (AWD Solenoid) is stored.



Figure 1

### ACTION

Replace the AWD Control Unit with the one listed in the Parts Information of this bulletin.

- Refer to the Electronic Service Manual (ESM), section DLN-Driveline, for replacement information.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

Replace the AWD Control Unit with the one listed in the Parts Information below (see Figure 2).

- Refer to the Electronic Service Manual (ESM), section DLN-Driveline, for replacement information.

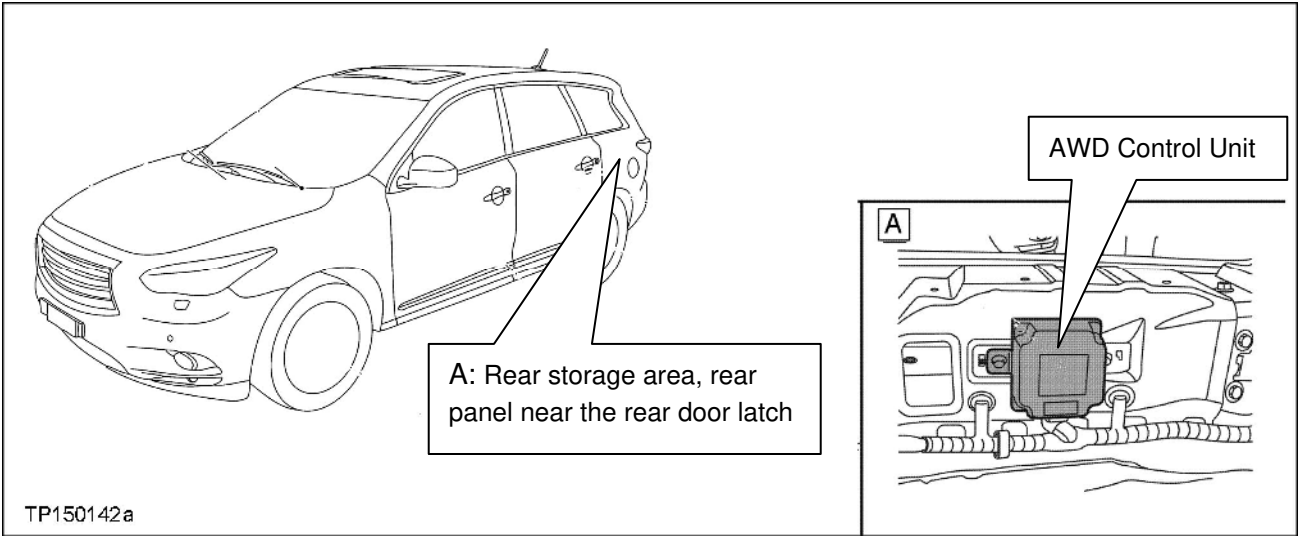


Figure 2

PARTS INFORMATION

| Description                                          | P/N           | Quantity |
|------------------------------------------------------|---------------|----------|
| Controller Assy - Torque Split<br>(AWD Control Unit) | 41650 – 9NB5A | 1        |

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

| DESCRIPTION                       | PFP           | OP CODE | SYM | DIA | FRT |
|-----------------------------------|---------------|---------|-----|-----|-----|
| Replace Torque Split Control Unit | 41650 – 9NB5A | RS36AA  | ZE  | 32  | (1) |

(1) Reference the current Infiniti Warranty Flat Rate Manual and use the indicated flat rate time.

