



SERVICE BULLETIN

Classification:

TF15-001

Reference:

NTB15-021

Date:

March 17, 2015

2013 – 2014 PATHFINDER 4WD ERROR DISPLAYED AND DTC C1204 STORED

APPLIED VEHICLES: 2013 – 2014 Pathfinder (R52) } Equipped with 4WD
2014 Pathfinder Hybrid (R52)

APPLIED VIN / DATE: Built before 5N1(*)R2M(**)EC 721752 / August 5, 2014

IF YOU CONFIRM

The vehicle has been operated in cold weather, below approximately -18°C (0°F),

and

4WD ERROR is displayed in the Vehicle Information Display.

and

DTC C1204 (4WD Solenoid) is stored.



Figure 1

ACTION

Replace the 4WD Control Unit with the one listed in the Parts Information of this bulletin.

- Refer to the Electronic Service Manual (ESM), section DLN-Driveline, for replacement information.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

Replace the 4WD Control Unit with the one listed in the Parts Information below (see Figure 2).

- Refer to the Electronic Service Manual (ESM), section DLN-Driveline, for replacement information.

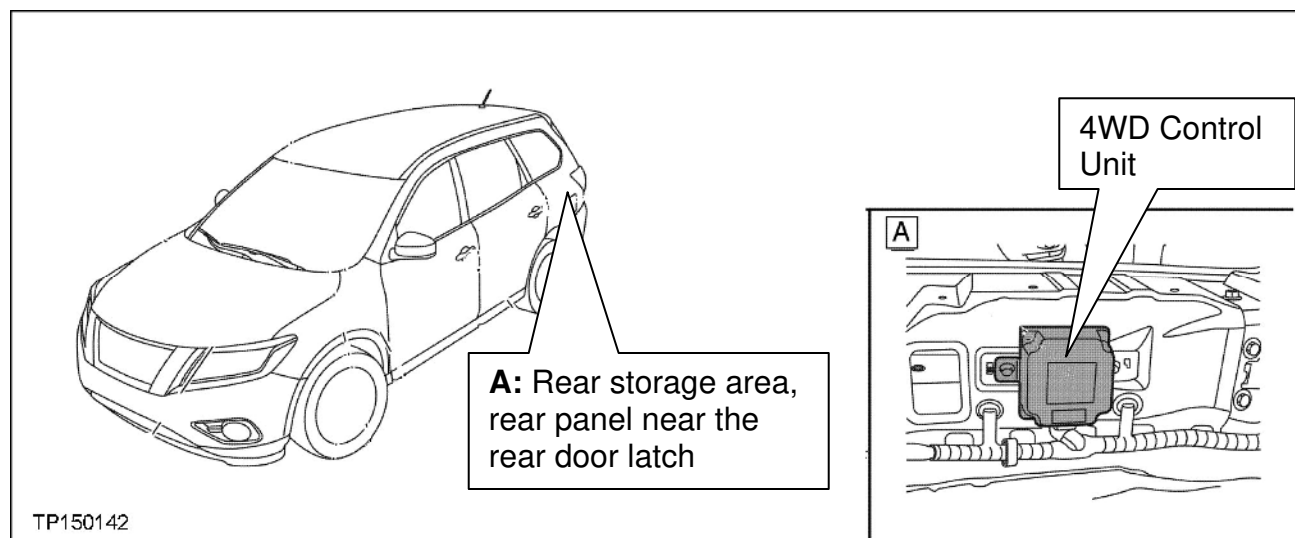


Figure 2

PARTS INFORMATION

DESCRIPTION	P/N	QUANTITY
Controller Assy - Torque Split (4WD Control Unit)	41650 – 9PB5A	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Torque Split Control Unit	41650 – 9PB5A	RS36AA	ZE	32	(1)

(1) Reference the current Nissan Warranty Flat Rate Manual and use the indicated flat rate time.