

Technical product information

Topic	New Continental GT - Adjustable rear spoiler fails to operate
Market area	Bentley: worldwide (2WBE),Hongkong-Macau (5HK)
Brand	Bentley
Transaction No.	2051524/3
Level	EH
Status	Approval
Release date	

New customer code

Object of complaint	Complaint type	Position
body fixtures and fittings -> spoilers, air intake grilles, brackets	functionality	
vehicle service -> vehicle diagnosis	control units, services	

Vehicle data

New Continental GT

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
3S3*	2018	E		*	*	*
3S3*	2019	E		*	*	*
3S3*	2020	E		*	*	*
3S3*	2021	E		*	*	*
3S3*	2022	E		*	*	*

Documents

Document name
master.xml

New Continental GT - Adjustable rear spoiler fails to operate

Customer statement / workshop findings

Adjustable rear spoiler fails to operate

Technical background

Diagnostic Trouble Code (DTC) logged in the Aerodynamics Control Unit (Address 6B) - The DTC is *B18AC19 Motor for rear spoiler drive 1 Current High*

Production change

All VIN's post SCBCA13S5JC069119 have a later specification Adjustable rear spoiler control unit (J223) fitted and should not be affected by this issue, however in the event that this issue is evident please raise a DISS query and await feedback before conducting any further work.

Measure

Replace the Adjustable rear spoiler control unit J223 - Refer to Elsa pro;

Rep.Gr 66 → Deployable rear spoiler → Adjustable rear spoiler control unit -J223- To remove and fit

Warranty accounting instructions

Time to replace the Adjustable rear spoiler control unit J223

Warranty Type	110 or 910
Labour operation code	66 74 19 00
Damage Service Number	66 74
Damage Code	0040
Time	40 Time units