

Technical Service Bulletin (TSB)

Incorrect Fuel Tank Installed

REFERENCE:	TSB: 14-010-26 GROUP: 14 - Fuel System	Date:	September 18, 2026	REVISION:	—
VEHICLES AFFECTED:	2026 (WL) Jeep Grand Cherokee / Grand Cherokee L This bulletin applies to vehicles built on or after January 01, 2026 (MDH 0101XX) and on or before March 05, 2026 (MDH 0305XX) equipped with 2.0L Hurricane 4 Turbo W/ESS (Sales Code EC7).			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☐ EE☐ CH NOTE: This bulletin applies to the North America market.	
CUSTOMER SYMPTOM:	Customers must experience a Malfunction Indicator Lamp (MIL) illumination and the vehicle must exhibit/set the following Diagnostic Trouble Code (DTC): P062A-00 - Fuel Pump "A" Control Circuit Range/Performance. No customer facing symptoms are reported other than the MIL illumination.				
CAUSE:	Build issue				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-173, date of issue September 18, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting the fuel tank part number and possibly replacing the fuel pump assembly.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
14-50-01-92	Pump, Fuel - Inspection (2 - Skilled)	14 - Fuel System	0.2 Hrs.
14-50-01-93	Pump, Fuel - Inspection and Replace (2 - Skilled)	14 - Fuel System	1.7 Hrs.
Failure Code	ZY	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	68721448AA	Module Kit, Fuel Pump/Level Unit	–
4 (AR)	06511894AA	Screw, Hex Flange Head, M10x1.5x40.80	Rear driveshaft center support bearing bolts.
3 (AR)	68541097AA	Bolt Kit	Rear driveshaft to transmission (RWD)
3 (AR)	68541102AA	Bolt Kit, Driveshaft to Transfer Case	Transfer case (4WD) flange bolts.
4 (AR)	68541103AA	Bolt Kit, Driveshaft to Rear Axle	Rear driveshaft to rear pinion flange bolts.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify that all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	–	–

REPAIR PROCEDURE:

1. Raise and support the vehicle. Refer to the detailed service procedures available in DealerCONNECT/ Service Library under: Service Info> 04 - Vehicle Quick Reference / Hoisting / Standard Procedure.

2. Locate the left side of the fuel tank [Fig. 1](#).



Fig. 1
Left Side Of Fuel Tank

1 - Left Side Of Fuel Tank

3. Use a small inspection mirror to place above the left most end of the fuel tank [Fig. 2](#) [Fig. 3](#).

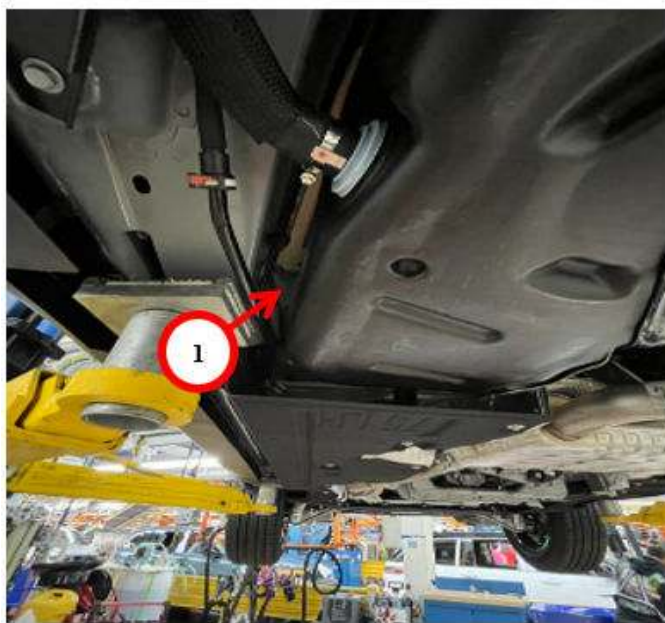


Fig. 2
Mirror Insertion Location For Inspection

1 - Inspection Location



Fig. 3
Mirror Capturing Parts Label On Fuel Tank

1 - Parts Label Location

4. Use adequate lighting and take photo of the mirrored label (two people required) [Fig. 3](#).
5. Check the photo taken for clarity and flip photo to correct the label direction [Fig. 4](#).

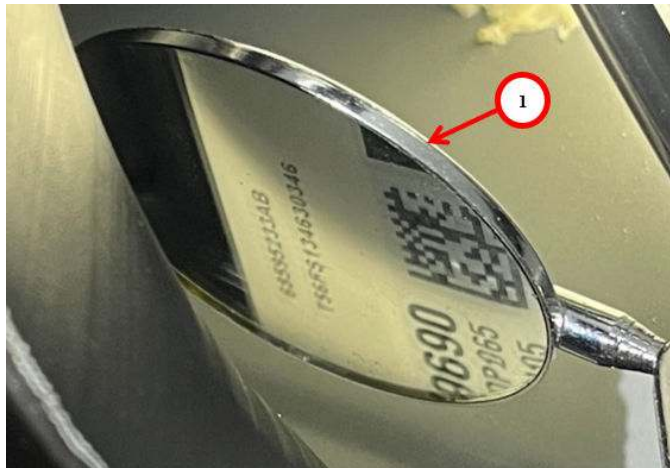


Fig. 4
Camera Image Flipped

1 - Part Label Image Capture

6. Is the fuel tank part number 68595233AA or 68595233AB?
 - YES>>> This bulletin has been completed. Use Inspection LOP (14-50-01-92) to close the active RSU.
 - NO>>> Proceed to [Step 7](#).
7. Replace the fuel pump. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 09 - Engine, 2.0L / Fuel System / Modules / Removal and Installation.
8. Clear DTCs.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.