



Technical Service Bulletin

48 Steering wheel heater is not working, DTC B145504 is stored in the steering column control module

48 19 77 2053869/1 February 5, 2019.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
All	2016 - 2019	All	Not Applicable

Condition

Customer states:

- Heated steering wheel is not working.

Workshop findings:

The following DTC may be stored in the steering column electronics control module, J527 (address word 0016):

- **DTC B145504** (Temperature sensor of steering wheel heating defective) (active/static) or (passive/sporadic) with symptom code 7340800.

Technical Background

The steering wheel heating can already switch itself off after 5 minutes. To switch it on, the customer must press the button of the steering wheel heater or an ignition cycle has to take place.

Climatic conditions lead to the premature deactivation of the steering wheel heating.

Production Solution

Not applicable.

Service

Clear the DTC and release the vehicle. Do not replace the steering wheel.



Note:

Replaced steering wheels will be debited.



Technical Service Bulletin

Warranty

Claim Type:	• 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4810		
Damage Code:	0040		
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 30 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2053869/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2053869) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2019 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.