



Preliminary Information

PIP5633 P015B Setting L84 L87

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (New Model)	2019	All	All	5.3 6.2 L82 L84 L87	All
GMC	Sierra 1500 (New Model)	2019	All	All	5.3 6.2 L82 L84 L87	All

Involved Region or Country	North America
Condition	A vehicle may have a check engine lamp on with a P015B stored.
Cause	Possible intake manifold or exhaust system leak

Correction:

- Before replacing any parts be sure to follow SI Document 4915712 and check for the following.
- B52 Heated Oxygen Sensor — Water intrusion at Harness Connector
- Coolant consumption » Refer to: Loss of Coolant
 - Vacuum leak at Engine / Hoses / Lines
 - Oil consumption » Refer to: Oil Consumption Diagnosis
 - Evaporative Emission Canister — Saturated with fuel
 - Fuel — Contaminated / Poor Quality » Refer to: Alcohol/Contaminants-in-Fuel Diagnosis
 - Fuel injectors which do not close completely. » Refer to: Fuel Injector Diagnosis
 - Fuel pressure that is too low or too high. » Refer to: Fuel System Diagnosis
 - Exhaust System — Leaking / Loose Clamps / Visible Damage » Refer to: Symptoms - Engine Exhaust
 - Fuel Injectors Restricted » Refer to: Fuel Injector Diagnosis

NOTE: As further information becomes available this PI will be updated or replaced with a bulletin as needed.

Version History

Version	1
Modified	03/15/2019 -Created on.



GENERAL MOTORS