



Preliminary Information

PIP5679 Diagnostic Aids For Injector Driver Codes

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 4500 MD, 5500 MD, 6500MD	2019	All	All	6.6L L5D	All

Involved Region or Country	North America
Condition	Diagnostic Aids For Injector Driver Codes DTCs P01CB, P01CC, P01CD, P01CE, P01CF, P01D0, P01D1, P01D2, P01D3, P01D4, P01D5, P01D6, P01D7, P01D8, P01D9, P01DA, set
Cause	This concern could be caused by switching the vehicle into 4WD and driving the vehicle with out locking the front hubs.

Correction:

If a vehicle comes in with more than one Small Quantity Adjustment (SQA) DTC set.
Any combination of codes could be set.
If the 4WD switch is placed in 4WD and driven without lock the hubs it could cause these codes to set.
Ask the customer if there was a chance that it was driven with 4WD switch on, but the hubs not locked.
If this is the case, clear the codes and advise the customer to make sure the hubs are locked in when the switching to 4WD.

Version History

Version	1
Modified	09/24/2019 - Created on.

