



Technical Journal

TITLE:

Fresh air hose loose from air filter housing

REF NO:
TJ 31319.3.0

ISSUING DEPARTMENT:
Technical Service

CAR MARKET:
United States and Canada

PARTNER:
3 US 7510 Volvo Car USA

ISSUE DATE:
2017-03-16

STATUS DATE:
2017-03-23

FUNC GROUP:
2560

FUNC DESC:
Air cleaner and throttle housing

Page 1 of 3

“Right first time in Time”

Attachment

File Name	File Size
TJ31319.jpg	0.0582 MB

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256	10	B4204T23					2016-2016	21	-	201537-201614

CSC Customer Symptom Codes

Code	Description
1Q	Driving/Poor performance/lacks power/At take off
AJ	Driving/Poor performance/lacks power
DL	Warning lights and chimes/Malfunction Indicator Light ("Check engine" light) indication/no indication

VST Operation Number

VST Operation Number	Description
99400-2	Exchange clamp
36001-2	Diagnostic trouble codes read/reset



DTC Diagnostic Trouble Codes

Control Module	Code	Fault Type
ECM	P226200	Permanent
ECM	P02CD00	Permanent
ECM	P200200	Permanent

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

DESCRIPTION:

* VST operation added.

If the “check engine” indicator is lit and DTC P226200 and/or P02CD00 is posted, this can be caused by loose fresh air hose at MAF sensor.

DTC P200200 may be posted as a consequential failure.

Please follow advice under service.

SERVICE:

If fresh air hose is loose from air filter housing, install spring clamp P/N 988016 to prevent repeat repair.
Tightening torque 4Nm.
See attachment.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area “Vehicle Report” and sub concern area “Support not needed”, use function group 2560.

To view TJ attachment continue to next page. This TJ has one attachment.

