

Reference	SSM73691
Models	Range Rover Velar / L560
Title	Park Brake warning message on Instrument Cluster - ABS Module DTC`s: C2007-13, C2008-13
Category	Electrical
Last modified	05-Jan-2018 00:00:00
Symptom	203000 Basic Electrical
Attachments	C34A Fault.pdf (C34A Fault.pdf) C34A Location.pdf (C34A Location.pdf)

Content

Issue:

Customer experiences park brake warning message on instrument cluster. Park Brake may not release

One or more of the following DTC's may be stored in the Anti-lock Brake System (ABS) Control Module:

C2007-13 - Right Motor - Circuit Open

C2008-13 - Left Motor - Circuit Open

Cause:

Loose connection at connection C34A – see pictures attached

Action:

Check connection at C34A/B in Left hand rear wheel arch

Check for any loose pins/backed out pins

Repair as required as per workshop manual

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.