



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-152

Date: May, 2016

TECHNICAL

Subject: Dead Battery, No Start, and/or DTC B1527

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac, Chevrolet, GMC	Escalade, Escalade ESV, Suburban, Tahoe, Yukon, Yukon Denali, Yukon XL, Yukon XL Denali	2016	2016	Build date prior to 12/1/2015		All	All

Involved Region or Country	North America and NA Export.
Condition	Some customers may comment on a dead battery or no start condition. During diagnosis, technicians may find DTC B1527.
Cause	The child window lock, when active, may cause the BCM to continuously wake up and run the battery down. The BCM may set a B1527, Parasitic Load detected.

Correction

1. Check and, if necessary, charge the battery.
2. Install the latest BCM calibration.

Service Procedure

Install the latest BCM calibration. Refer to *Body Control Module Reprogramming with SPS* in SI.

Warranty Information

Labor Operation	Description	Labor Time
2810215	Body Control Module Reprogramming with SPS	Use Published Labor Operation Time

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION