

P060C00 and P282212 Stored in TRANSMISSION 9G-Tronic VGS control unit

Topic number	LI27.60-P-064292
Version	1
Design group	27.60 Gearshift, control
Date	06-14-2016
Validity	213, 205 and 222 equipped with TRANSMISSION 725.0 9G-TRONIC
Reason for change	
Reason for block	

Complaint:

On PDI fault code P282212 in combination with P060C00 can be stored or active in the transmission control unit

Cause:

Signal timing when leaving transport mode

Remedy:

If codes are active, allow vehicle to sleep to allow codes to store

After codes store, clear codes. Vehicle is functioning as designed

Please note: These codes can occur in the vehicle with other root causes. This LI is specific for new delivery vehicles only.

Symptoms
Power transmission / Automatic transmission / Function / Electrical fault/Fault code

Control unit/fault code		
Control unit	Fault code	Fault text
Y3/8n4 - Transmission control for 9-speed transmission (VGS) (VGSNAG3)	P060C00	There is an internal control unit fault in the central processing unit. _
Y3/8n4 - Transmission control for 9-speed transmission (VGS) (VGSNAG3)	P282212	Pressure regulating valve 9 has an electrical fault. There is a short circuit to positive.