

Classification:

Reference:

COPYRIGHT© NISSAN NORTH AMERICA, INC.
Date:

EC18-014

ITB18-020

May 24, 2018

2019 QX50; SERVICE INFORMATION FOR DTC P11AB

APPLIED VEHICLES: 2019 QX50 (J55)

SERVICE INFORMATION

The Applied Vehicle has a Diagnostic Trouble Code (DTC) that can be stored if power is interrupted to the Variable Compression Ratio Control Module Circuit under certain conditions.

DTC P11AB – (VCR control module circuit) can be stored if:

- 12 volt power is interrupted while the ignition is ON, or up to 3 minutes after the ignition was turned OFF
 - Refer to the Electronic Service Manual (ESM). Search precautions for removing battery in Title Search for further information.
- Vehicle battery has low voltage
- Vehicle battery is incorrectly disconnected
 - Refer to the ESM. Search precautions for removing battery in Title Search for further information.
- ECU is disconnected before properly disconnecting the 12 volt battery

In these cases DTC P11AB will be accompanied by other DTCs related to low voltage or connection codes.

If P11AB is stored during one of the above conditions, with DTCs that are related to low voltage or connection issues, P11AB and related DTCs can be erased with no further action.

NOTE: If DTC P11AB is stored by itself, refer to the ESM for further diagnostic information.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.