



SSM 55208 2024-2026 F-150, 2025 Explorer/Aviator, 2025-2026 Expedition/Navigator, 2026 F-Super Duty – DTC U211B:43:48 Stored In the BCM

Some 2024-2026 F-150, 2025 Explorer/Aviator, 2025-2026 Expedition/Navigator, or 2026 F-Super Duty vehicles may exhibit diagnostic trouble code (DTC) U211B:43:48 stored in the body control module (BCM) when performing a Self-Test. This DTC sets due to an internal BCM timing issue during the self-test process. This specific code has no customer impact and does not cause any drivability concerns or warning messages. Clearing DTC U211B:43:48, reprogramming the BCM, or replacing the BCM is unlikely to prevent this DTC from setting. This DTC does not trigger a condition covered under warranty.

Note: This guidance only applies to U211B with the specific failure byte 43 in status 48. Any other trusted real-time operation network (TRON) DTCs or different failure bytes associated with U211B are still applicable and technicians must follow Workshop Manual (WSM) normal diagnostics for those DTCs.