

7/6/2016

MY16 WK

GPOP - Issue Review System

Part Number: 04670682A\$, 68253107A\$, 68253112A\$

Part Description: Shifter & PRNDL

Issue Description: For 2016 WK ONLY; If vehicle DTC Code U114C-00 (Loss of Communication with PRNDL Display) is verified as either stored or active please contact Aaron Barnes in FCA Chassis Engineering at cell (269) 420-1969.~ For S28 repair TECHtip see NOTE 2 below.

Note 1: This code can be generated by disconnecting the PRNDL from Shifter while battery is connected.

NOTE 2: If battery is NOT disconnected while servicing Shifter 04670682A\$: PRNDL power from Shifter will be deactivated after 3 seconds of being disconnected from Shifter. Power to Shifter will have to be removed for approx.. 20 seconds after PRNDL is connected to reset power to PRNDL from the Shifter. Power can be reset by removing battery power or disconnecting the shifter main connector. This is due to a safety feature built into the Shifter that will cut power to the PRNDL if a communication error is observed between the Shifter and PRNDL. Please return parts back to FCA Engineering if PRNDL is deemed non-functional after performing this TECHtip. ~

~

~

Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
