



Connection offline

Technical Service Bulletin

Transaction No.: **2076396/3**

90 Driver assist systems: Audi adaptive light, Audi pre sense system fault, adaptive cruise assist inop (DTC C12D5FA)

Release date: Sep 23, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment			
A6 allroad, A6, S6, RS 6 Avant, A7, A7 e quattro, S7, RS 7, A8, S8, e-tron, e-tron Sportback, Q8, SQ8, and RS Q8	2021 – 2022	All	00A5 - Front sensor for driver assistance systems			
			Software part number	Software version	Hardware part number	Hardware version
			*	0385	*	*
			*	0384	*	*
A8 e quattro	2021	All	*	0371	*	*
e-tron GT, and RS e-tron GT	2022		*	0381	*	*

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A8, S8, RS e-tron GT, Q8, SQ8, and RS Q8	2023 – 2027	All	Not applicable
A6 allroad, RS 6 Avant, and RS 7	2023 – 2026		
A6, S6, A7, and S7	2023 – 2025		
e-tron GT	2023 – 2024		
e-tron, and e-tron Sportback	2023		
Q7, and SQ7	2024 – 2026		
Q8 e-tron, Q8 Sportback e-tron, SQ8 e-tron, and SQ8 Sportback e-tron	2024		
S e-tron GT	2025 - 2027		

REVISION HISTORY

Revision	Date	Purpose
3	-	Revised header (add model years)

		Revised <i>Condition</i> (added model table)
2	10/17/2024	Revised header (Add Model Years)
1	12/17/2024	Initial publication

Customer states:

The driver assist systems are unavailable or there is a message displayed on the instrument cluster, for example:

- Audi adaptive light: system fault.
- Audi pre sense: system fault.
- Adaptive cruise assist: restricted.
- Adaptive cruise assist: predictive control currently restricted.

After switching the ignition off and back on again, or after a bus sleep cycle, the messages in the instrument cluster are no longer displayed and the systems are available again.

Workshop findings:

The following DTC and symptom code is stored in the *Driver assist systems control unit -J1121-* (address word 00A5):

- **DTC C12D5FA:** Driver assistance systems control module Image processing processor not reacting (symptom number **221281**) (sporadic)

GFF recommends replacing the driver assist systems control unit -J1121-.



CAUTION

This TSB does not apply in the event of an active/static issue. The TSB also does not apply if the DTC listed above is not stored.

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

Delete the DTC “**C12D5FA:** Driver assistance systems control module Image processing processor not reacting” (symptom number 221281). ”.

There is no reason to replace parts.

Warranty

The TSB number must always be noted in the “HST number” field in SAGA for ease of processing.

Replacing parts or attempting repairs will not fix the problem. Unjustified work/replacement parts will be charged back.

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9093		
Damage Code:	0039		
Labor Operations:	GFF / Guided Functions	0150 0010	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2076396/2		

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2076396**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.