

Technical Service Bulletin

Transaction No.: **2080077/4**

37 Gearbox warning lamp, drive system fault with event memory entry P060A00;
P1FD700

Release date: Sep 25, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment			
A5, S5 (FU), Q5, Q5 Sportback, SQ5, and SQ5 Sportback (GU)	2025	All up to CW 36/25	00A5 - Front sensor for driver assistance systems			
			Software part number	Software version	Hardware part number	Hardware version
			*	0250	*	*
			*	0295	*	*

REVISION HISTORY

Revision	Date	Purpose
4	-	Revised <i>Condition</i> (Updated model table) Revised <i>Production Solution</i> (Updated verbiage) Revised <i>Service</i> (Updated verbiage) Revised <i>Warranty</i> (Added accounting instructions) Revised <i>Additional Information</i> (Updated verbiage)
3	01/30/2026	Revised header (Added software version)
2	12/18/2025	Revised header (Added Model Year) Revised <i>Condition</i> (Updated model table) Revised <i>Warranty</i> (Updated Labor Operations)

Customer states:

- The gearbox warning lamp lights up in the instrument cluster.

and/or

- There is no customer complaint, and the DTC specified in the workshop findings is found in automatic gearbox control unit J217 in connection with a different complaint.

Workshop findings:

The following DTC is logged in transmission electronics control unit J217 (diagnostic address 0002):

- **P060A00:** Control module internal processor monitoring malfunction (symptom 20899).

and/or

The following DTC is logged in the control unit for drive system and running gear functions -J1312- (diagnostic address 812C):

- **P1FD700:** Transmission control module warning light request active (symptom 385025).

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

Please remove all electronic auxiliary equipment (e.g. electronic tachograph at OBD socket) from the vehicle. This equipment could have an effect on the vehicle electronics and trigger this complaint.

This bulletin replaces PSS TSB 2079003, *37 PSS Gearbox warning lamp, drive system fault with DTC P060A00; P1FD700*.

Combined software update

The complaint is solved with the target combined software version 03.10.00/C [KD2]. This combined software package has already been rolled out.

Please note that the KD package may have been superseded by a subsequent combined software update.

All information about the current schedule and availability of the measure can be found in central service information TSB 2081477.

Please also note any changes in the warranty accounting instructions.

Warranty

If you are billing according to the warranty guidelines, please note the following accounting instructions:

The “HST number” field must be completed in the SAGA/2 system.

Claim Type:	• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	3410		
Damage Code:	KD2S		
Labor Operations:	Please refer to the central service information TSB 2081477	Work for a combined software update	Please refer to the central service information TSB 2081477
Claim Comment:	As per TSB 2080077/4		

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The software must be updated on a control unit in this vehicle, or the software must be updated on several control units in this vehicle to ensure they function correctly in conjunction with the other control units in the vehicle. Please inform the customer about the software update in question and ask whether they or other third parties have modified the software (e.g. tuning or retrofitting involving modifications to the vehicle's software). Please inform the customer that this software update may neutralize previous modifications to the vehicle's software performed either by the customer or other third parties.

If the customer declines the software update, please inform them that this could lead to issues or restrictions with the use of the vehicle or individual components.

Make a note to this effect on the order before it is signed by the customer. Include this information in the customer file.

It is also possible to reset individual user settings for the assist systems to the default settings. These settings can be adjusted individually by the vehicle users themselves after the software update.

All part and service references provided in this TSB (**2080077**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.