



Connection offline

## Technical Service Bulletin

Transaction No.: **2083444/1**

91 Driver assist systems: distance warning + ACC unavailable / Audi pre sense fault  
(U101400 / B203200) - Q3

Release date: Sep 30, 2026

## Condition

| Model(s) | Year(s)     | VIN Range | Vehicle Specific Equipment     |                  |                      |                  |
|----------|-------------|-----------|--------------------------------|------------------|----------------------|------------------|
| Q3       | 2021 – 2025 | All       | 0013 - Adaptive cruise control |                  |                      |                  |
|          |             |           | Software part number           | Software version | Hardware part number | Hardware version |
|          |             |           | *                              | 0534             | *                    | *                |
|          |             |           | *                              | 0543             | *                    | *                |
|          |             |           | *                              | 0541             | *                    | *                |
|          |             |           | *                              | 0396             | *                    | *                |

### Customer states:

The customer complains that various driver assist systems are unavailable. A related message is shown in the instrument cluster.

- Distance warning: currently unavailable. See owner's manual
- Audi pre sense: fault. Please contact workshop
- Audi pre sense: currently restricted. See owner's manual

### Workshop findings:

The following **active/static** event memory entries are logged in adaptive cruise control unit -J428- (DA0013):

- **B203200**: no enable identification active, symptom 1807
- **B203200**: no enable identification active, symptom 201225
- **U101400**: Control module incorrectly coded, symptom 201217
- **U101400**: Control module incorrectly coded, symptom 201219
- **U101400**: Control module incorrectly coded, symptom 201224

**or**

- **U101300**: Control module not coded, symptom 1811

## Technical Background

Software issue

## Production Solution

Not applicable.

## Service

The following steps must be performed in order to restore the system function:

### Step 1:

End current ODIS diagnostic session, switch terminal 15 off and on again and then start a new diagnostic session.

### Step 2:

Perform a new set-up of **adaptive cruise control unit -J428-** and **data bus diagnostic interface -J533-** via the “Replace control module” test plan. It is **not** necessary to replace the hardware.

### Step 3:

Restore any existing function activations in data bus diagnostic interface -J533- as follows:

- Special functions
- SVM Activations
- Restore already existing activations

## Warranty

If you are billing according to the warranty guidelines, please note the following accounting instructions:

|                          |                                                                                                     |           |                                       |
|--------------------------|-----------------------------------------------------------------------------------------------------|-----------|---------------------------------------|
| <b>Claim Type:</b>       | • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. |           |                                       |
| <b>Service Number:</b>   | 9163                                                                                                |           |                                       |
| <b>Damage Code:</b>      | 0039                                                                                                |           |                                       |
| <b>Labor Operations:</b> | GFF / Guided Functions                                                                              | 0150 0010 | See SRT with associated operations    |
|                          | GFF / Guided Functions                                                                              | 0150 0060 | Labor according to the diagnostic log |
| <b>Claim Comment:</b>    | As per TSB 2083444/1                                                                                |           |                                       |

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

For adjustment work on various assist systems, use the available items from the Suggested Repair Time (SRT), as well as any associated tasks.

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## **Additional Information**

All part and service references provided in this TSB (**2083444**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

**©2026 Audi of America, LLC / Audi Canada Inc.** All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.