



Preliminary Information


PIP5468 Check Engine Light On with DTCs P0101, P0299, P11CC, P11DC, P2002 and / or P20EE set.

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 2WD	2017	All	All	6.6 L5P	All
Chevrolet	Silverado 4WD	2017	All	All	6.6 L5P	All
GMC	Sierra 2WD	2017	All	All	6.6 L5P	All
GMC	Sierra 4WD	2017	All	All	6.6 L5P	All
Involved Region or Country	North America					
Additional Options (RPO)	6.6 L5P					
Condition	Some customers may comment on a Service Engine Soon Light / Check Engine Light on. Upon inspection technicians may find DTCs P0101, P0299, P11CC, P11DC, P2002 and / or P20EE set.					
Cause	These DTCs may be the result of loose connections of the charged air cooler ductwork.					

Correction:

If any combination of DTCs P0101, P0299, P11CC, P11DC, P2002 or P20EE are set; check for loose charged air cooler ductwork at the turbocharger outlet pipe, the charged air cooler inlet pipe, the charged air cooler outlet pipe and the connection at the throttle body. Please note that a static visual inspection may not reveal that the connection is not adequate and that it is most likely to occur during engine roll or brake torque.

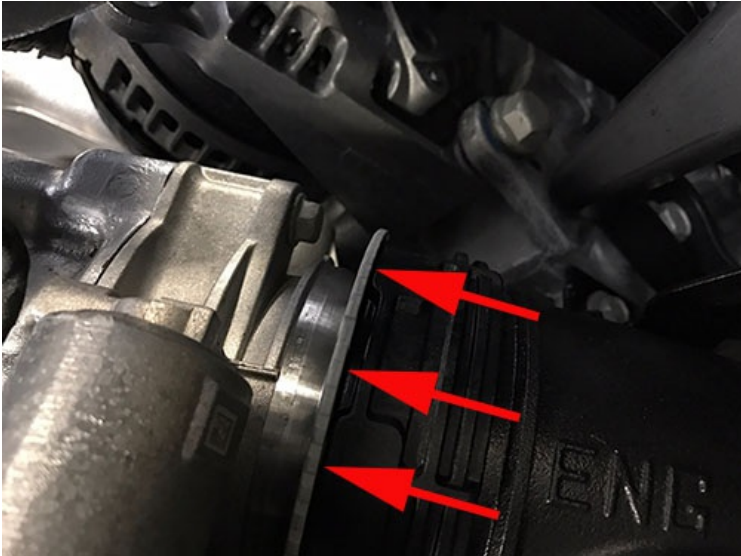

Picture of a non-secured connection between the charged air cooler pipe and the throttle body.

Version History

Version	1
Modified	

