



Preliminary Information

PIP5529 Stall Hesitation P0068 P0101 P0106 P0131 P0137 P0171 P0324 P0326 P0331 P0506 P2097
PIP5529 LCV LKW LTG Loose Intake Manifold Bolts

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Envision	2016 - 2017	All	All	LCV LTG	All
Buick	Regal	2014 - 2017	All	All	LTG	All
Cadillac	ATS	2013 - 2017	all	all	LTG LCV	All
Cadillac	CT6	2016 - 2017	all	all	LTG	All
Cadillac	CTS	2014 - 2017	all	all	LTG	All
Chevrolet	Camaro	2016 - 2017	all	all	LTG	All
Chevrolet	Colorado	2015 - 2017	all	all	LCV	All
Chevrolet	Malibu	2013 - 2017	all	all	LCV LKW LTG	All
Chevrolet	Impala	2014 - 2017	all	all	LCV LKW	All
GMC	Acadia	2017	all	all	LTG	All
GMC	Canyon	2015 - 2017	all	all	LCV	All
Involved Region or Country		North America				
Condition		In rare cases, some customers may comment that the malfunction indicator lamp is on, vehicle has a hesitation or may stall. Technicians may find any combinaton of diagnostic trouble codes P0068 P0101 P0106 P0131 P0137 P0171 P0324 P0326 P0331 P0506 P2097.				
Cause		If service information does not lead to a solution, inspect the intake manifold bolts for being loose.				

Correction:

If the intake manifold bolts were loose, torque them to proper specification. Replacing the intake manifold gasket is typically not necessary.

Version History

Version	1
Modified	

