



SERVICE BULLETIN

Classification:

EL18-003

Reference:

NTB18-017

Date:

February 27, 2018

NISSAN; SERVICE INFORMATION FOR DTCs B2EF0 AND B130C

APPLIED VEHICLES: 2016-2018 Altima (L33) 2017-2018 Pathfinder (R52)
2018 Armada (Y62) 2016-2018 Rogue (T32)
2017-2018 GT-R (R35) 2017-2018 Rogue Sport (J11)
2016-2018 Maxima (A36) 2016-2018 Sentra (B17)
2017-2018 Murano (Z52) 2016-2018 Titan and Titan XD (A61)
2018 LEAF (ZE1)

APPLIED SYSTEM: Vehicles equipped with Telematics

SERVICE INFORMATION

Diagnostic information in the Electronic Service Manuals (ESM) for the following DTCs may be missing or incorrect:

- B2EF0 – INTERNAL BATTERY (CIRC VOLT BELOW THRESHOLD)
- B130C – TCU (Telematics Control Unit) PAIRING ERROR

If one of these DTCs is stored, follow the steps listed below along with the Electronic Service Manual (ESM) to complete the required repairs.

DTC B2FE0 – INTERNAL BATTERY (CIRC VOLT BELOW THRESHOLD):

1. Start the engine and let it idle for 30 minutes (to allow charging of the TCU internal battery).
 - 2018 LEAF only: Put the vehicle in Ready to Drive mode (depress the brake pedal and depress the power ["ignition"] switch) for 30 minutes.
2. Verify the DTC can be erased.
3. If the DTC will not erase, replace the TCU.

DTC B130C:

1. Collect all keys, and then re-register them to the vehicle.
2. Verify the DTC can be erased.
3. If the DTC will not erase, replace the TCU.

NOTE: The related Electronic Service Manuals (ESM) will be updated at a later date.

CLAIMS INFORMATION

Refer to the current Nissan Warranty Flat Rate Manual and submit a claim for the repairs performed.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.