



Preliminary Information

PIT5609 SES Lamp with DTC U1345

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Enclave	2018	All	All	All	All
Chevrolet	Traverse	2017 - 2018	All	All	All	All
Involved Region or Country		North America				
Condition		SES Lamp on with DTC U1345				
Cause		Water getting in connection at the upper and lower Aero Shutters				

Correction:

Inspect the terminals/connectors at the upper and lower Aero Shutters for water in the connector and/or corroded terminals. If connection is able to be cleaned up, then clean up the connection and apply di-electric to the terminals and before re-install. If the connection cannot be cleaned up, replace the connector and apply di-Electric when before re-installing. Engineering is still investigating the root cause
Note: DO NOT CALL GM Technical Assistant Center
PI will be updated to a bulletin once the final root is understood

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	1
Modified	Created on 3/27/2018

