



Technical Service Bulletin

90 Driver assist systems: Audi adaptive light, Audi pre sense system fault, adaptive cruise assist inop (DTC C12D5FA)

90 24 55 2076396/1 December 17, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A6 allroad, S6, RS 6 Avant, A7, S7, RS 7, A8, S8, A8, SQ8, and RS Q8	2021 – 2025	All	Not Applicable
e-tron, and e-tron Sportback	2021 – 2023		
A7 e quattro	2021 – 2022		
A8 e quattro	2021		
e-tron GT, and RS e-tron GT	2022 – 2025		
Q7, SQ7, Q8 e-tron, Q8 Sportback e-tron, SQ8 e-tron, and SQ8 Sportback e-tron	2024 – 2025		

Condition

Customer states:

The driver assist systems are unavailable or there is a message displayed on the instrument cluster, for example:

- Audi adaptive light: system fault.
- Audi pre sense: system fault.
- Adaptive cruise assist: restricted.
- Adaptive cruise assist: predictive control currently restricted.

After switching the ignition off and back on again, or after a bus sleep cycle, the messages in the instrument cluster are no longer displayed and the systems are available again.

Workshop findings:

The following DTC and symptom code is stored in the *Driver assist systems control unit* -J1121- (address word 00A5):



Technical Service Bulletin

- **DTC C12D5FA:** Driver assistance systems control module Image processing processor not reacting (symptom number **221281**) (sporadic)

GFF recommends replacing the driver assist systems control unit -J1121-.

CAUTION

This TSB does not apply in the event of an active/static issue. The TSB also does not apply if the DTC listed above is not stored.

Technical Background 1

Not applicable.

Production Solution

Not applicable.

Service

Delete the DTC “**C12D5FA:** Driver assistance systems control module Image processing processor not reacting” (symptom number 221281”).

Do not replace any parts! Replacing parts will not remedy the customer complaint.

Warranty

CAUTION

Replacing parts or attempting repairs will not fix the problem. Unjustified labor/replacement parts will be debited.

Claim Type:	• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9093		
Damage Code:	0039		
Labor Operations:	Charge Battery	2706 8950	See SRT with associated operations



Technical Service Bulletin

	GFF	0150 0000	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2076396/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2076396**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.