

Technical Service Bulletin

Transaction No.: **2074786/3**

94 Warning lamp for exterior lighting displayed in instrument cluster: DTC U112100, U110B00, B126A29

Release date: Dec 11, 2025

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A3, S3, RS 3, Q4 e-tron, and Q4 Sportback e-tron	2022 -2024	All	Not applicable

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised <i>Service</i> (updated procedure) Revised <i>Warranty</i> (Updated warranty table)
2	09/26/2025	Revised <i>Condition</i> (Updated DTC verbiage) Revised <i>Production solution</i> (Updated sw and part number index)
1	08/01/2024	Initial publication

Customer statement:

A warning lamp for the exterior lighting or adaptive light is displayed in the instrument cluster. The lighting system appears to be working as it should.

This phenomenon occurs only very occasionally.


Pressing the “AUTO” button on the light switch module remedies the fault immediately and causes the warning lamp to go out.

Workshop findings:

The concern can be reproduced. The following DTCs are stored in the onboard supply control unit J519 (address 0009):

- **DTC B126A29** Light switch implausible signal
- **DTC U112100** Data bus missing message.
- **DTC U110B00** Light switch no communication.

All lighting functions are working.

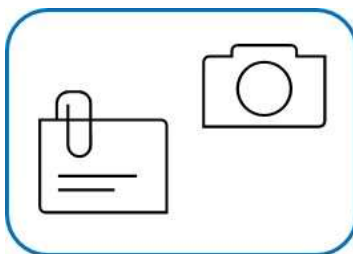

Documentation required

Technical Background

Software issue

Production Solution

Depending on vehicle type, new light switch with optimized software 0013 and new part index AC,AD.

Service

This TSB Closes PSS 20373612: 94 PSS Headlight warning in cluster, DTC : B126A29, U110B00 stored in 09 module.

Check whether the situation is as described above.

Pressing the “AUTO” button will cause the warning lamp to go out and the DTC entry to change to intermittent.

The DTC can then be deleted.

If it is not possible to delete the DTC and the entry remains logged as static, the light switch must be replaced.



If only DTC “U110B00 Light switch no communication” is stored without the other entries, the cause may be a loose connector, a pin that has been pushed back or a wiring problem.

When billing, please always attach photos that clearly show the complaint to DOC-IT. To ensure a reference to the vehicle, the image(s) must:

- Include the VIN and date.
- Must not be edited.
- Should be in focus and taken with sufficient light. A high resolution is not necessary.

If appropriate, please mark the location of the problem so that parts analysis has a clear reference to the complaint. Please ensure that the photo documentation does not show any people and/or faces, license plates, or customer data.

Warranty

Claim Type:	• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. • Replace and repair labor operations cannot be claimed together. Only bill according to what was needed.
Service Number:	9405

Damage Code:	0040		
Labor Operations:	Replacing light switch (only if DTC cannot be cleared)		
	Remove and install main light switch	9405 19xx	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Labor according to the diagnostic log
	Repairing light switch (only if replacing the switch is not necessary)		
	Repair light switch	9405 4199	Bill according to the time required
	GFF / Guided Functions	0150 0010	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Labor according to the diagnostic log
Claim Comment:	As per TSB 2074786/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (**2074786**) are subject to change and/or removal.

©2025 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.