



Connection offline

Technical Service Bulletin

Transaction No.: **2080044/3**

35 Gearbox: Position P cannot be selected or yellow engine warning lamp lights up.
DTC DA:812C - P288B00, P1D4700

Release date: Jan 30, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A5, S5 (FU), Q5, Q5 Sportback, SQ5, and SQ5 Sportback (GU)	2025	All from CW 36/25	Not applicable

REVISION HISTORY

Revision	Date	Purpose
3	-	Revised header (Added software version)
2	12/18/2025	Revised header (Added Model Year) Revised <i>Condition</i> (Updated model table) Revised <i>Warranty</i> (Updated labor operations)
1	11/19/2025	Initial publication

Customer states:

- Transmission position P (parking lock) cannot be selected. The vehicle therefore cannot be locked.

and/or

- Yellow warning lamp: "Drive system: fault" appears in instrument cluster

Workshop findings:

- The yellow warning message "P cannot be selected. Vehicle may roll away! Please contact workshop" appears in the instrument cluster.

and/or

The following DTC (static/intermittent) may be logged in the main control unit for drive system and running gear systems (diagnostic address 812C):

- P1D4700:** "Parking lock Time exceeded for display" with symptom 262145

and/or

- P288B00:** "Park Lock/Pawl Actuator Circuit Performance" with symptom 401414

Technical Background

Not applicable

Production Solution

Optimized software from week 36/2025.

Service

This bulletin replaces PSS TSB 2078844, *35 Gearbox: Position P cannot be selected or yellow engine warning lamp lights up. DTC DA:812C - P288B00, P1D4700.*

 NOTICE

Try to reproduce the customer complaint (based on the description/cause of the issue), so that it can be clearly assigned to this TSB. The following repair must only be carried out if all the criteria (model/type, chassis number, engine/motor, gearbox code, PR number(s), part number, software version, code, etc.) apply exactly. Otherwise, this solution will not eliminate the problem and repeat repairs may be necessary. In such a case, the warranty claim may be rejected, and the cost of the parts may be charged back.

Please perform the software update described in TSB 2079690, *00 Combined software update 03.10.00/C (28.13.01) KD2.*

Then proceed as follows regarding the message “P cannot be selected” in the instrument cluster:

- Switch off the ignition so that the instrument cluster and the transmission position display on the selector lever turn off.
- Then wait three minutes without operating the vehicle; for example, do not open any of the doors and do not use the MMI.
- Please start the vehicle in combustion mode, drive forward approx. 20 inches in **transmission position S** and then reverse approx. 20 inches in transmission position R (you can also do this in the opposite order).
- Then press the P button on the selector lever.
- **Please inform the customer that the electronic parking brake (EPB) will continue to function and can be used to park the vehicle.**

Warranty

Claim Type:	• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	3410		
Damage Code:	KD02		
Labor Operations:	Software update, including connecting battery charger	0151 0010	See SRT with associated operations
	Fixed rate for software update, including all required preliminary and follow-up work (including bus sleep cycle, calibration drives, and additional work)	0151 0040	130 TU
	In the case of additional attempts, an additional lump sum of 50 time units is possible per flash	0150 9999	50 TU

Claim Comment:	cancellation.		Per each documented attempt
	Check gear lever housing	3410 0199	10 TU
	As per TSB 2080044/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

When performing the combined software update, time stamps are not required for billing under warranty. You are therefore permitted to work on other vehicles at the same time. The combined software update can also be performed by non-productive personnel.

Additional Information

All part and service references provided in this TSB (**2080044**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.