



STAR ONLINE PUBLICATION



Case Number: S2621000001

Release Date: February 2026

Symptom/Vehicle Issue: Service shifter message, unable to shift out of park. Code P0607 sets in the ESM.

Models Affected: 2026 LB Charger

Diagnosis/Repair:

- A)** If code P0607 will not switch to a stored status or returns when cleared, then replace the ESM (shifter module) and confirm proper operation.
- B)** If after a key-cycle code P0607 goes stored and does not return, the shifter should operate normally with no warning messages. If the above condition exists, please do not replace the ESM (shifter module) or any other parts as a software update is expected in the 2nd Quarter to address this concern. If the service shifter message returns in the cluster, then please advise the customer that cycling the key should return the ESM (shifter) to proper operation.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.