

Check engine light or Adblue warning with fault codes P206B31, P203B31, or P300494 present in AdBlue (SCR) control unit (N118/5)

Topic number	LI49.20-N-078838
Version	10
Function group	49.20 - Exhaust gas aftertreatment
Date	2/24/26
Validity	Model 907
Reason for change	Remedy Update

Complaint

The check engine light or AdBlue warning is activated, accompanied by one or more of the following fault codes related to the AdBlue tank:

P206B31: Malfunction of the concentration sensor for AdBlue; the signal is absent.

P203B31: Malfunction of the AdBlue fill level sensor; the signal is absent.

P300494: The quality of the AdBlue is insufficient.

Cause

- A. The software for the AdBlue (SCR) control unit (N118/5) is outdated.
- B. The concentration of AdBlue is either above or below the Mercedes-Benz specifications, which can lead to premature freezing.
- C. Frozen or partially frozen AdBlue can cause the AdBlue level sensor to misread levels.
- D. The AdBlue level sensor is damaged.

Remedy

A. Software

1. Verify no newer software in AdBlue® SCR control unit (N118/5).
2. Complete LI49.20-N-075995 for Adblue warning reset.

--NOTE-- If there is no updated software available, print the XENTRY screen indicating this and proceed to step B.

B. Adblue Concentration

1. Verify the AdBlue concentration
 - a. According to WIS AR49.20-D-9264TS - Check the concentration of AdBlue
 - b. Per the freeze frame data 'Development data (Urea Qualitaet Rohwert)', see attachment 'Urea Quality'.

--NOTE-- If the AdBlue concentration is below 31.8% or above 33.2%, it must be replaced. Please note that this will be at the customer's expense.

2. If the AdBlue concentration is within the approved specifications, please proceed to step C.

Adblue Concentration.png

XENTRY

 Mercedes-Benz

No.	Name	Actual value	Specified value
119	Fill level of AdBlue® tank (Value in percent)	72%	[0 ; 100]
592	Fill level of AdBlue® tank	19.9L	[0.9 ; 22.0]
637	Fill level sensor 1 (Raw value)	1mm	[17 ; 60]
743	Fill level sensor 2 (Raw value)	222mm	[25 ; 335]
726	Temperature in AdBlue® tank	19°C	[11 ; 60]
846	There is frozen AdBlue® in component 'Subblue® tank'.	YES	NO
616	AdBlue® concentration	0.00%	[20.0 ; 29.0]
521	Longitudinal acceleration	0.00m/s²	[-20.0 ; 20.0]
114	AdBlue® concentration	-10%	

Adblue Concentration

Adblue Fill Level.mp4

Adblue Fill Level 1

Urea Quality.png

Urea Quality

XENTRY

 Mercedes-Benz

Fault	Text	Status
P20031	Concentration sensor 'AdBlue®' has a malfunction. The signal is not present.	A-S 
	Name	First occurrence
	Latral acceleration (Raw value) [AC_TRV_VEH_RAW]	0.16m/s²
	Longitudinal acceleration (Raw value) [AC_VEH_RAW]	0.16m/s²
	Development data (converted_value_based_on_timeBaseStatus)	15
	Development data (Current, Operating, Time)	1193.0h
	Development data (Fehler-Status Levelsensor)	49152.00
	Development data (Filtered reducing agent tank volume (0: Fast filtered, 1: Slow filtered) in high resolution (RTL_VOL_FIL_H_RES[0]))	19.61L
	Development data (Filtered reducing agent tank volume (0: Fast filtered, 1: Slow filtered) in high resolution (RTL_VOL_FIL_H_RES[1]))	19.61L
	Development data (Freigabe der Füllstandsfunktion durch Beschleunigungssignale)	1793.00
	Development data (LF_STATE_RAG_TANK_SENS)	49280.00
	Development data (Reducing agent tank ultrasonic wave Amplitude (AMPL_RAG_UCLS[0]))	7.40
	Development data (Reducing agent tank ultrasonic wave Amplitude (AMPL_RAG_UCLS[1]))	0.80
	Development data (Reducing agent tank ultrasonic wave Amplitude (AMPL_RAG_UCLS[2]))	6.90
	Development data (Reducing agent tank ultrasonic wave Quality (QLY_RAG_UCLS[0]))	87.00
	Development data (Reducing agent tank ultrasonic wave Quality (QLY_RAG_UCLS[1]))	49.00
	Development data (Reducing agent tank ultrasonic wave Quality (QLY_RAG_UCLS[2]))	81.00
	Development data (Reducing agent tank ultrasonic wave Runtime (RT_RAG_UCLS[0]))	22.15µs
	Development data (Reducing agent tank ultrasonic wave Runtime (RT_RAG_UCLS[1]))	46.94µs
	Development data (Reducing agent tank ultrasonic wave Runtime (RT_RAG_UCLS[2]))	29.41µs
	Development data (Rest HWL Menge im Tank in Liter)	19.61L
	Development data (RTL_CONT_SENS_FIL_MAX_DIAG_0)	1.00mm
	Development data (RTL_MES_SENS_MAX_VCT_0)	1.00mm
	Development data (RTL_MES_SENS_MIN_VCT_0)	1.00mm
	Development data (Tankfüllstand in mm gefüllt[0])	1.00mm
	Development data (Tankfüllstand in mm gefüllt[1])	0.00mm
	Development data (Urea Qualität Rohwert)	33.58%
	Development data (Urea Tank Füllstand Rohwert (Combi Piezo))	0.00mm
	Development data (Urea Tank Füllstand Rohwert (Direkt Piezo))	1.00mm
	Development data (Ureapiezor, Size 4, 7)	15
	Development data (Vector for Reducing agent tank levels measured by a continuous level sensor, (index 0: direct, index 1: combi) (RTL_CONT_SENS_VCT[0]))	0.00L
	Development data (Vector for Reducing agent tank levels measured by a continuous level sensor, (index 0: direct, index 1: combi) (RTL_CONT_SENS_VCT[1]))	0.40L
	Development data (Vehicle Odometer in Low Resolution)	366km
	Total distance	366km
	Operation time	1193.0h

WIS-References

Document number	Title	Note
AP49.20-D-0101TS	AdBlue(R) tank - Check/correct fluid level	
AR49.20-D-2015TS	Empty/fill AdBlue(R) tank	
AR49.20-D-2014TSF	Remove/install AdBlue(R) tank	

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service

technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms
Power generation > Fuel system > Fuel tank > Function > Different level
Power generation > Exhaust system > AdBlue > AdBlue consumption > Too high

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A9104702401			NOX REDUCING AGENT TANK	1		X

Control unit/fault code	
Control unit	Fault text
N118/5 N141 - Selective catalytic reduction (SCR GEN4) (UDCM2)	P203B31 - The AdBlue® fill level sensor has a malfunction. The signal is not present.
	P206B31 - Concentration sensor 'AdBlue®' has a malfunction. The signal is not present.
N3/40 - Motor electronics 'MRD1' for combustion engine 'OM654' (CDI) (MRD1NFZ)	P300494 - The AdBlue® quality is insufficient.

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
470643	Check separate parts of AdBlue(R) system: ... as per fault code	0.7 H		This Operation item is used for completing LI49.20-N-075995.
499264	Check AdBlue(R) concentration (After quick test)	H		
499290	Empty/fill AdBlue(R) tank	H		
499292	Replace AdBlue(R) tank	H	4707250	
540650	On-board power supply voltage Maintain (when checking/testing and troubleshooting)	H		
540990	Program, code control unit (After quick test)	H		If newer software is available
541011	Perform quick test	H		