



Connection offline

Technical Service Bulletin

Transaction No.: **2081057/1**

43 Air suspension control unit J1330 - Warning message about air suspension
C141D07

Release date: Feb 18, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
Q5, Q5 Sportback, SQ5, SQ5 Sportback (GU)	2025 – 2026	All	With PR Code: 1BK or 2MB

Customer states:

A yellow message about the air suspension is displayed in the instrument cluster:

- *“Air suspension: fault. Please contact workshop”*

Workshop findings:

The *air suspension control unit* (J1330; diagnostic address 8131) has **software version 0842** and the following DTC is logged in J1330:

- **C141D07**: Valves for air supply system mechanical malfunction

Technical Background

Not applicable

Production Solution

From production date 04/23/2025 onward.

Service

Please perform the following steps one after another:

1. Select “Special functions” on the ODIS tester and perform “Check SVM vehicle configuration”.
2. Turn off the ignition and disconnect the diagnostic cable.
3. Close the vehicle doors and lock the vehicle.
4. Wait at least 5 minutes.
5. Unlock the vehicle.
6. Connect the diagnostic cable to the vehicle and turn on the ignition.
7. Exit diagnosis via the ODIS tester (this deletes the above DTC).

If the DTC in question is still logged, follow the instructions in Guided Fault Finding.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4316		
Damage Code:	0039		
Labor Operations:	Check vehicle (bus sleep mode)	0689 0199	10 TU
	GFF/Guided Functions	0150 0010	See SRT with associated operations
	GFF/Guided Functions	0150 0060	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2081057/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Try to reproduce the customer complaint (based on the description/cause of the issue), so that it can be clearly assigned to this TSB. The following repair must only be carried out if all the criteria (model/type, chassis number, engine/motor, gearbox code, PR number(s), part number, software version, code, etc.) apply exactly. Otherwise, this solution will not eliminate the problem and repeat repairs may be necessary. In such a case, the warranty claim may be rejected, and the cost of the parts may be charged back.

Additional Information

All part and service references provided in this TSB (**2081057**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.